



Village of Harwood Heights Draft Lead Service Line Replacement Plan

REL Project 22-R0903

April 15, 2026



Table of Contents

1.0	Overview	1
1.1	Introduction	1
2.0	Background Information	1
2.1	Location	1
2.2	Community Water Supply (CWS).....	1
3.0	Lead Service Line Inventory (LSLI)	2
3.1	Summary.....	2
3.2	Previous Replacements.....	3
4.0	Funding Considerations	3
4.1	SRF PWSLP	3
4.2	Other Possible Federal & State Funding Sources.....	3
4.2.1	Illinois Department of Commerce and Economic Opportunity (DCEO) Grant.....	4
4.2.2	HUD Community Development Block (CDB) Grant.....	4
4.2.3	Congressional Discretionary Funding.....	4
4.2.4	United States Environmental Protection Agency (USEPA) Community Change Grants	4
4.3	Potential Funding.....	4
5.0	Prioritization.....	4
5.1	SRF PWSLP	5
5.2	Emergency Work-related Lead Service Line Replacement (EW-LSLR).....	5
6.0	Lead Service Line Replacement (LSLR)	5
6.1	Scope of LSLR.....	5
6.2	Replacement Methods	5
6.3	Completed LSLR.....	7
7.0	Workforce Development.....	7
8.0	Resident Communication and Outreach	7

Appendices

Appendix 1	Code of Ordinances
Appendix 2	Complete Lead Service Line Inventory
Appendix 3	Prioritization Map
Appendix 4	IEPA SRF PWSLP Scoring System
Appendix 5	LSLR Details
Appendix 6	Lead Service Line Replacement Outreach Materials

Harwood Heights

1.0 Overview

1.1 Introduction

The Lead Service Line Replacement and Notification Act (Act), State of Illinois Public Act 102-0613, went into effect on January 1, 2022. This Act required that every owner or operator of a community water supply (CWS) that has known or suspected lead service lines (LSLs) create a plan to replace each lead and galvanized service line (if connected downstream of lead piping); submit that initial plan to the Illinois Environmental Protection Agency (Agency) by April 15th, 2024; submit by April 15th of each year after 2024 until 2027 an updated lead service line replacement plan to the Agency; and submit by April 15th, 2027 a final lead service line replacement plan to the Agency. The Act also requires that the plan is posted on the community water supply's website.

This Plan will be updated at least each April as the Village updates its replacement program.

The Village of Harwood Heights has prepared this second annual Lead Service Line Replacement Plan (Plan) in compliance with the Act and its requirements. The Plan includes the name and identification number of the CWS; an inventory of the total service lines, known and suspected LSLs, and LSLs that have been replaced since 2020; a proposed replacement schedule; a cost analysis with financing options; a prioritization plan; community outreach measures; and workforce development measures.

2.0 Background Information

2.1 Location

The Village of Harwood Heights is located in Cook County in northeastern Illinois approximately 14 miles northwest of downtown Chicago. The Village is bounded by Chicago to the north and east, and Norridge to the west and south. The Village corporate boundaries encompass an area of approximately 0.82 square miles.

2.2 Community Water Supply (CWS)

The Community Water Supply (CWS) is named Harwood Heights and is IEPA Water System No. IL0311140. The CWS serves a population of 9,065 and has 2,225 service connections as reported to the IEPA.

A service line is the small diameter pipe that connects the water main to the interior plumbing inside a building. The CWS takes ownership of the service line from the water main to the water shut-off valve or Buffalo Box (b-box)/curb stop while the property owner takes ownership of the service line from the water shut-off valve or Buffalo Box (b-box)/curb stop according to the City's Code of Ordinances, listed in Appendix 1. The b-box/curb stop is typically installed near the property line.

Service lines can be made of the following materials: copper, galvanized iron, lead, cast or ductile iron, or PVC. Since the CWS owns and maintains one portion and the property owner owns and maintains the other portion, there is a possibility that the CWS owned portion and property owner portion may be different materials.

A graphic of a service line is included in Figure 1.

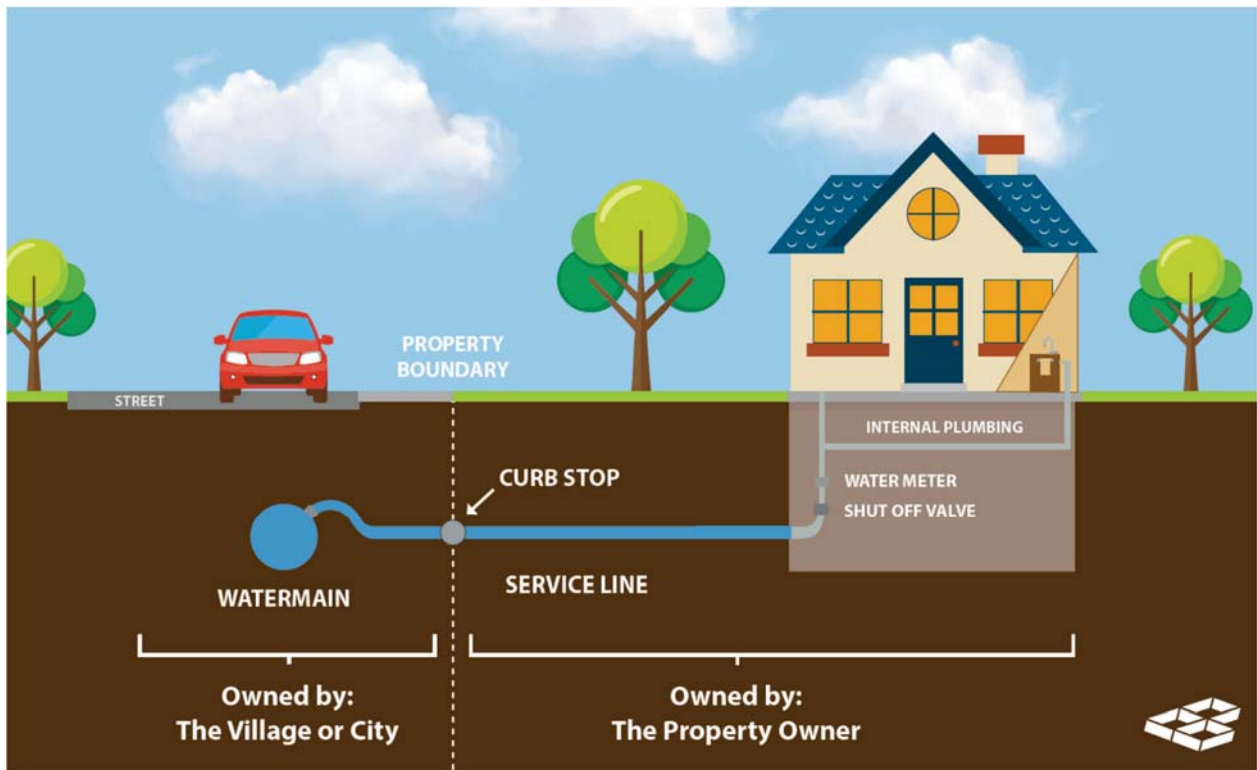


Figure 1. Service Line Graphic

3.0 Lead Service Line Inventory (LSLI)

3.1 Summary

The definitions of water service line materials in the CWS's inventory adheres to the definitions provided by the Illinois EPA. These definitions are outlined in the table below.

Service Line Material
Copper – No Lead Solder (C)
Copper- Lead Solder (CLS)
Galvanized (G)
Plastic – PVC, HDPE, PEX (P)
Galvanized Requiring Replacement (GRR)
Lead (L)
Cast/Ductile Iron or Transite (O)
Unknown (U)
Unknown Not Lead (UNL)

The CWS has made ongoing efforts to complete its inventory. These efforts include those listed below: reviewing resident surveys, water meter replacement records, a property's building age, exploratory excavations at targeted locations, visual inspection of interior service lines, and predictive modeling for properties without known material type.

- **Building Age:** For those buildings constructed after 1986, service lines are assumed to be non-lead on both the public and private sides.
- **Historical Records:** Where available, historical records were used to identify service line material. The CWS has recorded service line material for most addresses in the system during a water meter replacement project.
- **Visual Identification:** The CWS staff recorded service line material when entering private property.

- **Exploratory Excavations:** Very few records contain information on the public-side service line material. A contractor excavated in the parkway to determine public-side material at select locations to determine lead density throughout the service area.
- **Predictive Modeling:** A machine learning model was used to predict the material of the service line for those addresses that do not have historical records, could not be visually verified, do not have a survey response, and where the contractor has not completed an exploratory excavation.

The current inventory includes:

- The total number of services lines in the CWS for the current year;
- The material composition of each service line in the CWS's distribution system;
- The count of suspected lead service lines identified since the last inventory submission;
- The number of suspected or known lead service lines replaced since the last inventory submission

A copy of the inventory submitted to the Agency that lists the total number of service line connections, total LSLs, and total suspected LSLs is included in Appendix 2.

Service Line Material	# of Services
Lead (L)	206
Unknown (U)	5
Galvanized Requiring Replacement (GRR)	0
Not Lead	2014

3.2 Previous Replacements

The CWS has replaced five (5) LSLs since 2020.

4.0 Funding Considerations

The funding sources for the Lead Service Line Replacement (LSLR) Program will be considered and evaluated in this section. The CWS plans to use the State Revolving Fund Public Water Supply Loan Program (SRF PWSLP) administered by the Illinois Environmental Protection Agency (IEPA) to fund the LSLR Program. The SRF PWSLP awards funding on an annual basis for LSLR programs. The CWS has pursued funding for the last two years and will continue to pursue funding until replacements are completed.

Based on an inventory of 206 LSLs and a replacement cost of \$11,000, the CWS will need \$2,299,000 to fund the entire LSLR Program. The CWS will plan to replace the maximum number of LSLs covered by the SRF PWSLP each year.

4.1 SRF PWSLP

The IEPA SRF loan program awards loans according to census tract scoring that considers demographic information that will be discussed in more detail in the Prioritization section.

The CWS has not received any forgivable loans to date. The CWS has applied for a forgivable loan for fiscal year 2026

The SRF PWSLP funding is awarded based on census tracts and therefore can only be used in certain areas of the CWS. The project area for each forgivable loan is identified in the Prioritization Map in Appendix 3. The Prioritization Map only includes those areas of the CWS that have LSLs; any area not included in the priority groups on the map do not contain lead water service lines.

4.2 Other Possible Federal & State Funding Sources

Other possible funding sources would be periodically evaluated for favorability and affordability. These funding sources could include:

Illinois Department of Commerce and Economic Opportunity (DCEO) Grants
HUD-administered Community Development Block Grant (CDBG)
Congressional Discretionary Funding
United States Environmental Protection Agency (USEPA) Community Change Grants
LeadCare Cook County
Rebuild Illinois Program

4.2.1 Illinois Department of Commerce and Economic Opportunity (DCEO) Grant

The Office of Community Development supports economic development, community development, and infrastructure improvements in Illinois communities with substantial low-to-moderate-income populations. Various DCEO grants can be used for LSLR funding. The CWS will periodically review available grants.

4.2.2 HUD Community Development Block (CDB) Grant

The Office administers the federally funded Community Development Block Grant (CDBG) program that assists low-income populations. LSLR Programs are eligible for CDBG funding in qualifying areas. The CWS will evaluate their eligibility for CDBG funding.

4.2.3 Congressional Discretionary Funding

Each member of the United States Congress receives an allotment of grant funding to be used at their discretion annually. While no funding has been awarded and it is unlikely that Congressional Discretionary Funding will be a significant source of funding, this source of funding is still an option to fund a portion of a project.

4.2.4 United States Environmental Protection Agency (USEPA) Community Change Grants

The USEPA has recently funded \$2 billion for the Community Change Grants to be used in pollution reduction projects, which would include lead service line replacements. The maximum amount the CWS may receive for lead service line replacements is \$20 million. The below census tracts are eligible for Community Change Grant funding. Those census tracts that are in bold are unlikely to receive IEPA SRF funding and are the suggested project areas for a Community Change grant award.

Census Tract	LSLs
Census Tract 8106, Cook County, Illinois	51
Census Tract 7709.01, Cook County, Illinois	155
Census Tract 8105.02, Cook County, Illinois	3

4.3 Potential Funding

The CWS could use a combination of any of the methods discussed above to generate sufficient funds to cover the replacement costs. However, it is the intent of the CWS to maximize grants and forgivable loan awards to cover LSLR costs.

5.0 Prioritization

The CWS has a limit of replacements that it can achieve each year. There are only so many contractors available to do replacements each year, and there is a lack of contractors to focus on such a large scale project in a single year. There is also a significant amount of logistics involved in coordinating with property owners to obtain permission to enter a property to complete the replacement, and the work required to gain permission to all properties on a street takes a significant amount of time. The CWS is also committed to completing the replacements without taking funds from the water and sewer fund, raising water rates, or requiring property owners to pay a portion of the replacement cost. As a result, it must adopt a prioritization framework for choosing which neighborhoods will be included in each year's replacement project.

5.1 SRF PWSLP

The SRF PWSLP funding is awarded to the highest scoring applicants until funding is exhausted that year. The forgivable loan for each year must be used for LSL replacements within the census tracts that are submitted on each annual application. Each application is scored according to demographic data of each tract, and the highest scoring applications are awarded funding. Therefore, in order to maximize the amount of funding the CWS receives, the project areas are prioritized according to the SRF PWSLP scoring system.

The CWS will also prioritize replacements in high-risk facilities such as daycares, schools, parks, hospitals, and nursing homes within each project area.

The scoring system developed by the IEPA for the SRF PWSLP is included in Appendix 4.

5.2 Emergency Work-related Lead Service Line Replacement (EW-LSLR)

LSLR instances arising from emergency repairs often require an on-call contractor to complete the work of drilling a service line into a private building. The IL LSLR&N Act states that the CWS must provide the option of replacing a property owner's service line if the property owner requests the full replacement. The CWS is not required to fund the full replacement. Funding terms will be discussed at the time of the work.

The CWS shall consider developing an on-call contractor pool through a qualifications process that can bid on individual project's emergency work.

6.0 Lead Service Line Replacement (LSLR)

6.1 Scope of LSLR

The work shall consist of the removal and replacement of lead or galvanized iron water services for buildings within the specified service area. The area will be determined based on prioritization, material, building age, and funding limits, but all will be within the corporate boundaries of the CWS. New copper service lines shall be installed for full and partial lead service line replacement. Full lead service line replacement shall be defined as connecting from the water main to inside the building. Partial service line replacement shall be defined as connecting from the curb box (B-box or buffalo box) to the water main or from the curb box to inside the home, but not both. No lead piping will be left in the water system. Partial replacements will only occur where the existing service is partially lead or galvanized. Cross-sectional replacement details are included in Appendix 5.

Replacements will begin in Census Tract 8106. These replacements are expected to last four years at the mandated replacement rate but will depend on the maximum amount of annual IEPA SRF funding received.

6.2 Replacement Methods

The methods of installing the new service are described below. To minimize impacts to residential property and to reduce restoration, trenchless methods are preferred.

Open cut: Open cut trenching is sometimes used when the distance is short between the water main and the curb box for a public partial replacement. It involves digging a trench, which can cause significant exterior disruption to property owners. Interior disturbances depend on whether the basement is finished. This approach is advised based on individual circumstances.

Trenchless: Trenchless installation of water services is being explored to address concerns such as economic impact, landscape disruption, and social inconveniences associated with traditional open cut methods. Advances in trenchless technologies offer a more efficient alternative in certain situations, minimizing surface disruption and restoration time. These methods are socially appealing as they cause less destruction and require less restoration compared to open cut techniques.

Standard Horizontal Directional Drilling: Standard Horizontal Directional Drilling (HDD) involves using a drill rig on the ground surface to create a tunnel underground. To reach a depth of about 5'6" below the ground surface, the drill rig head must be positioned approximately 30 feet away from the final depth point of the water service. This may require closing the road for safety.

Pipe pulling: Pipe pulling is the most cost-effective method among trenchless options for installing water services. It involves using the path of the existing pipe, eliminating the need for additional excavation. A new water service pipe is pulled along the existing route, often with a winch or excavator bucket with a cable. The new copper service is connected to the existing lead service in the home, effectively replacing it using the borehole left by the removed lead pipe.

The connection to the water main typically incorporates the use of a tapping sleeve and is done by a licensed plumber. The licensed plumber also connects the new service line to the existing water meter inside the house according to the State of Illinois plumbing code.

Prior to beginning the work of connecting the new service inside the house, the water supply to the service line and the property owner shall be shut off to avoid release of particulate lead into the property owner's premises. After all connections have been completed, the Contractor shall flush the water from an outside connection (such as a hose bibb or hose leading from the building side of the meter) to remove any particles in the service line. Flush at full velocity for at least 30 minutes. The Contractor shall then advise the property owner to flush the interior premise plumbing in accordance with the instructions provided in the Owner-provided informational material. This work shall be conducted in accordance with AWWA C810-17 – Replacement and Flushing of Lead Service Lines.

Prior to completion of the work, the Contractor shall provide each address that received a new service line with a Point of Use water filter that meets both NSF/ANSI 42 and 53 certifications for lead reduction with a minimum capacity of 0.5 gallons and six months of replacement cartridges or a minimum of 150 gallons of filtration capacity. The filter shall not be a permanent faucet filter. The Contractor shall have the resident provide a signature to acknowledge receipt of the filter on a form provided by the Village. The form shall be turned in with other documentation.

Three to six months following the replacement, the property owner will have the option to request a water sample from their tap to test lead levels. The contractor will coordinate delivery of the sample bottle and instructions, pick-up of the sample bottle, delivery to the laboratory, testing of the sample, and distribution of the results.

The Village will use these standards when performing lead service line replacement:

Item	Condition
1. Restoration of Interior and Exterior	Meet existing condition or better
2. Parkway/Yard Restoration	Sod, Seed in Summer
3. Field Locate B-boxes	Location by Village
4. Trench backfill	CA-7
5. Verify B-box operation at Project Completion – after surface restoration	B-boxes keyed by Village
6. Street Cross Sections	Minimum 6-inch pavement patching
7. Work Hours	Monday to Friday 7 am to 7 pm Saturday 8 am to 7 pm No Work Sunday or Holidays, except Contractor my Schedule meeting/inspection at buildings on Sunday.
8. Meter Pits	Village will be consulted prior to relocating meter to building interior and abandoning the meter pit. Contingency Pay Item for this work included in contract.
9. B-box	Mueller H-10302, Minneapolis Pattern or approved equal

10. Curb stop	Mueller Ball Style: H15150 or approved equal
11. Corp Stop	Mueller H-15000 or approved equal
12. Saddle for corp stop	Smith-Blair or Ford Repair Clamp
13. Abandon existing Lead Service Line	Cap.

6.3 Completed LSLR

The CWS has completed a total of 5 replacements during maintenance and repair work since 2020.

7.0 Workforce Development

In performing projects associated with the Lead Service Line Replacement initiative, the CWS plans to develop the workforce available to perform these projects. These developmental practices include:

Smaller bids: The CWS will break the required replacements into smaller projects within the CWS, so that the bids will be smaller and more attainable for smaller firms.

College engagement: The CWS will engage with local colleges and institutions to train new individuals entering the workforce.

Hiring local: The CWS will include a clause within the scope of work for interior work and inspections to be conducted by local contractors who have an understanding of the community.

Experience contractor teaching: An experienced contractor teaches a smaller contractor how to perform the work.

Diversity in hiring practices are another aspect to workforce development and would include contacting all local MBE and WBE contractor associations during bidding.

8.0 Resident Communication and Outreach

To ensure effective community engagement, the CWS's outreach program for the Lead Service Line Replacement (LSLR) initiative will employ various communication methods aimed at informing and involving homeowners. Central to the program's success is consistent and informative communication across multiple platforms, including meetings, press releases, door-to-door notifications, and social media channels. By leveraging these diverse communication channels, the program aims to raise widespread awareness about the significance of the LSLR program and the options available for homeowners to participate. Early successes of the program will be shared with the community to foster positive feedback and encourage support for the initiative.

To effectively communicate the goals and requirements of the LSLR program, a comprehensive outreach & communication plan is developed, outlining key messaging, target audiences, and preferred communication methods. Emphasis will be placed on building trust and transparency with homeowners, ensuring they understand the benefits of participating in the program. Notices will be sent to homeowners at least 45 days before the commencement of work, with repeated notifications every two weeks until confirmation of receipt. Special attention will be given to non-English speakers, providing translated notices and instructions for accessing additional resources. As previously mentioned, the Community Outreach and Public Engagement plan will be vast, consistent, and includes:

Stakeholder Identification: The CWS has Identified key stakeholders, including residents, local businesses, community organizations, schools, healthcare providers, and governmental agencies.

Educational Materials: The CWS is developing comprehensive educational materials explaining the importance of lead service line replacement, potential health risks associated with lead exposure, details of the replacement process, and available resources for assistance.

Multi-Channel Communication: The CWS plans to utilize a variety of communication channels to reach different segments of the community, including:

Printed materials such as program brochures, flyers, door hangers and direct mail distributed to households, businesses, and public spaces.

Digital platforms including the village website, email newsletters, and community forums.

Information sessions and workshops held at community centers, schools, and other public venues.

Door-to-door outreach by trained community volunteers or outreach workers to engage directly with residents.

Language and Accessibility: The CWS will ensure that all materials and communication efforts are available in multiple languages to accommodate the linguistic diversity of the community. Additionally, make information accessible to individuals with disabilities by providing alternative formats such as large print or audio versions.

Community Workshops and Events: The CWS has plans to organize community workshops, town hall meetings, and informational events where residents can learn more about the lead service line replacement program, ask questions, and provide feedback. Offer opportunities for hands-on demonstrations or tours of the replacement process and an avenue for public comment on the LSLR plans.

One-on-One Assistance: The CWS intends to provide personalized assistance and support to residents who may have questions or concerns about the replacement program. Establish a dedicated hotline or helpline staffed by knowledgeable personnel to address inquiries and provide guidance.

Collaboration and Partnerships: The CWS plans to collaborate with local organizations, community groups, schools, healthcare providers, and government agencies to amplify outreach efforts and leverage existing networks and resources.

Ongoing Engagement: The CWS will maintain ongoing communication and engagement with the community beyond the initial outreach phase. Provide regular updates on the progress of the replacement program, share success stories, and continue to address any concerns or issues that arise.

Non-Participation/Waivers: Homeowners in the CWS may not always be ready to engage with or communicate regarding the LSLR program. At present, the CWS lacks the authority to mandate homeowner access to private property or demand access for replacing the private side of the LSL. For those who choose not to participate, an Illinois Department of Public Health waiver form will be available. Efforts to communicate will be recorded for unresponsive homeowners. Nevertheless, these households will still receive complimentary point-of-use filters along with six replacement cartridges.

Appendix 1

Code of Ordinances

13.04.090 - Responsibility for repairs.

- A. Three-quarter inch and one inch services are the responsibility of the village to repair from the main to the B-box. It is the owner's responsibility to make all repairs from the B-box to the meter and beyond.
- B. For all water services that are larger than one inch, the responsibility for the repair of such lines belongs to the user from the village water main to the meter and beyond.

(Prior code § 52.17)

Appendix 2

Complete Lead Service Line Inventory



Lead Service Line Inventory Template

*Please enter information in the empty box next to each section	Water System Name		Harwood Heights		System ID Number:		IL0311140		Current Inventory Date:		4/15/2025		
*Please enter totals in the empty box next to each category	Total Service lines:	2225	Total Lead:	206	Total Non-Lead:	2014	Total Galvanized Requiring replacement:	0	Total Unknown:	5	Website link to Material Inventory:	https://www.harwoodheights.org/public-works/water-quality-report/	

Service Address	Lead and Copper Sample site number	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
	EXAMPLES: Lead and Copper Sample site number is the 7 digit number starting with "14P" or "1A", / If address is not a lead and copper sample site mark "N/A"	EXAMPLES: Group Homes, Parks, Playgrounds, Special Care Facilities, Hospitals, Clinics, Child Care Facilities Yes (Y) or No (N)	Yes (Y) or No (N)	What year was the PWS-Owned service line installed, if known?	What year was the customer side service line installed, if known?	How was the Material of this Service Line Identified? EXAMPLES: Construction Records, Visual Inspections, Survey Response, Maintenance Records, etc.	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Lead (L) Lead/Bottle Iron or Transite (DI) Plastic - PVC, HDPE, PEX (P) Unknown (U) Unknown Not Lead (UNL)	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Galvanized Requiring Replacement (GR) Lead (L) Lead/Bottle Iron or Transite (DI) Plastic - PVC, HDPE, PEX (P) Unknown (U) Unknown Not Lead (UNL)	EXAMPLES: Copper - No Lead Solder (C) Copper - Lead Solder (CLS) Galvanized (G) Galvanized Requiring Replacement (GR) Lead (L) Lead/Bottle Iron or Transite (DI) Plastic - PVC, HDPE, PEX (P) Unknown (U) Unknown Not Lead (UNL)	EXAMPLES: Lead (L) Galvanized Requiring Replacement (GR) Non-Lead (NL)	If any galvanized service line material was ever downstream of a Lead section, mark Yes (Y). If the galvanized service line material was never downstream of any Lead section, mark No (N). / If Yes, that section of service line should be marked as Galvanized Requiring Replacement in the appropriate immediately preceding column(s). If Service Line is not Lead put N/A	Enter date customer was notified of Lead Service Line. / If Service Line is not Lead put N/A	Yes (Y) or No (N)	If previous column was marked (Y), provide date the Lead Service Line was replaced. / Leave blank if previous column was (N).	EXAMPLES: Copper - No Lead Solder (C) Galvanized (G) Plastic - PVC, HDPE, PEX (P) Lead/Bottle Iron or Transite (DI) Leave blank if no Lead Service Line was replaced.	Yes (Y) or No (N)	If customer refused access to property, date waiver obtained by PWS or date PWS notified IDPH of refusal to sign waiver. / Leave blank if customer has not refused access.
4203 N NEWCASTLE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4205 N NEWLAND AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4207 N NEWLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4211 N NEWLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4212 N NEWCASTLE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4213 N NEWLAND AVE	N/A	N	N	1985	1985	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4214 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4216 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4217 N NEWLAND AVE	N/A	N	N	1975	1975	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4218 N NEWCASTLE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4219 N NEWLAND AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4220 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4226 N NEWCASTLE AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4223 N NEWLAND AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4224 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4225 N NEWLAND AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4226 N NEWLAND AVE	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4226 N NEW ENGLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4228 N NEWCASTLE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4229 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4229 N NEWLAND AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4230 N NEW ENGLAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4231 N NEWCASTLE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4232 N NEWCASTLE AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4233 N NEW ENGLAND AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4233 N NEWLAND AVE	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4234 N NEW ENGLAND AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4234 N NEWCASTLE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4235 N NEW ENGLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4235 N NEWCASTLE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4235 N NEWLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4236 N NEW ENGLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4237 N NEW ENGLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4237 N NEWLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4238 N NEW ENGLAND AVE	N/A	N	N	1992	1992	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4239 N NEW ENGLAND AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4240 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4240 N NEWCASTLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4241 N NEWCASTLE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4241 N NEWLAND AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4242 N NEWCASTLE AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4241 N NEWCASTLE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4243 N NEWLAND AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4244 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4245 N NEW ENGLAND AVE	N/A	N	N	1982	1982	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4247 N NEWCASTLE AVE	N/A	N	N	1992	1992	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4247 N NEWLAND AVE	N/A	N	N	1932	1932	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4248 N NEW ENGLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4249 N NEW ENGLAND AVE	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4249 N NEWCASTLE AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4249 N NEWLAND AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4250 N NEW ENGLAND AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4251 N NEW ENGLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4253 N NEW ENGLAND AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4253 N NEWLAND AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4254 N NEW ENGLAND AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4256 N NEW ENGLAND AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4257 N NEW ENGLAND AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4257 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4259 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4260 N NEW ENGLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4261 N NEW ENGLAND AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4261 N SAYRE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4262 N NEW ENGLAND AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4262 N NEWLAND AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4265 N NEW ENGLAND AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4300 N NEW ENGLAND AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4300 N NEWCASTLE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4300 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4301 N NEW ENGLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4301 N NEWCASTLE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4301 N NEWLAND AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4301 N SAYRE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4302 N NEWCASTLE AVE	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4303 N NEW ENGLAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4304 N NEW ENGLAND AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4304 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4305 N NEWCASTLE AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4305 N NEWLAND AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4305 N SAYRE AVE	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4306 N NEWCASTLE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4306 N NEWLAND AVE	N/A	N	N	1979	1979	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4307 N NEW ENGLAND AVE	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4307 N NEWLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4307 N SAYRE AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4308 N NEW ENGLAND AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4309 N NEWCASTLE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4310 N NEWCASTLE AVE	N/A	N	N	1993	1993	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4310 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4311 N NEWCASTLE AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4311 N NEWLAND AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4311 N SAYRE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
4312 N NEW ENGLAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4312 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4312 N NEWLAND AVE	N/A	N	N	1993	1993	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4313 N NEW ENGLAND AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4313 N SAYRE AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4315 N NEW ENGLAND AVE	N/A	N	N	1932	1932	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4315 N NEWCASTLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4315 N NEWLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4316 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4316 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4316 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4316 N OAK PARK AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4316 N RUTHERFORD AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4317 N NEW ENGLAND AVE	N/A	N	N	1928	1928	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4317 N NEWCASTLE AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4317 N NEWLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4317 N SAYRE AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4318 N NEW ENGLAND AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4318 N NEWCASTLE AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4318 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4318 N OAK PARK AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4319 N SAYRE AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4320 N NEW ENGLAND AVE	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4320 N RUTHERFORD AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4321 N NEW ENGLAND AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4321 N NEWCASTLE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4321 N NEWLAND AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4321 N SAYRE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4322 N NEWCASTLE AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4322 N NEWCASTLE AVE	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4322 N OAK PARK AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4322 N RUTHERFORD AVE	N/A	N	N	1923	1923	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4323 N NEW ENGLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4323 N NEWCASTLE AVE	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4323 N SAYRE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4324 N NEW ENGLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4324 N NEWCASTLE AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4324 N NEWLAND AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4324 N OAK PARK AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4324 N RUTHERFORD AVE	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4325 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4325 N NEWCASTLE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4325 N NEWLAND AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4325 N OAK PARK AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4326 N NEW ENGLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4326 N RUTHERFORD AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4327 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4327 N NEWCASTLE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4328 N NEWCASTLE AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4328 N NEWLAND AVE	N/A	N	N	1945	1945	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4328 N OAK PARK AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4329 N NEW ENGLAND AVE	N/A	N	Y	1948	1948		U	U	U	U	N		N			N/A	N/A
4329 N NEWLAND AVE	N/A	N	N	2011	2011	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4329 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4330 N NEW ENGLAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4330 N NEWCASTLE AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4330 N OAK PARK AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4331 N NEWCASTLE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4331 N OAK PARK AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4331 N SAYRE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4332 N NEWLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4332 N RUTHERFORD AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4333 N NEW ENGLAND AVE	N/A	Y	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4333 N NEWCASTLE AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4333 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4333 N SAYRE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4334 N NEW ENGLAND AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4334 N NEWCASTLE AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4334 N NEWLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4334 N OAK PARK AVE	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4334 N RUTHERFORD AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4335 N NEW ENGLAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4335 N NEWCASTLE AVE	N/A	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4335 N NEWLAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4335 N OAK PARK AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4336 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4336 N NEWCASTLE AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4336 N OAK PARK AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4336 N RUTHERFORD AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4337 N NEWCASTLE AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4337 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4338 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4338 N RUTHERFORD AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4339 N NEWLAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4339 N OAK PARK AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4339 N SAYRE AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4340 N NEW ENGLAND AVE	N/A	N	N	1983	1983	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4340 N NEWCASTLE AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4340 N NEWLAND AVE	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4341 N NEW ENGLAND AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4341 N NEWLAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4341 N OAK PARK AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4342 N OAK PARK AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4343 N NEWCASTLE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4343 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4343 N OAK PARK AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4343 N SAYRE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4344 N NEW ENGLAND AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4344 N NEWCASTLE AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4344 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4345 N NEW ENGLAND AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4345 N NEWCASTLE AVE	N/A	N	N	2021	2021	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4347 N OAK PARK AVE	N/A	N	N	1923	1923	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4348 N OAK PARK AVE	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4348 N RUTHERFORD AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4350 N OAK PARK AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4352 N OAK PARK AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4352 N RUTHERFORD AVE	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4353 N OAK PARK AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4354 N OAK PARK AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4355 N OAK PARK AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4355 N OAK PARK AVE	N/A	N	N	1925	1925	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4359 N NEW ENGLAND AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4359 N OAK PARK AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4360 N OAK PARK AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4361 N OAK PARK AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4362 N OAK PARK AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4365 N OAK PARK AVE	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4366 N OAK PARK AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4369 N OAK PARK AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4370 N OAK PARK AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4372 N OAK PARK AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4373 N OAK PARK AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4375 N OAK PARK AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4403 N NEWCASTLE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4407 N NEWCASTLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4408 N OAK PARK AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4411 N NEWCASTLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4412 N OAK PARK AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NAGLE AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NATCHEZ AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NEENAH AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NEW ENGLAND AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NEWCASTLE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4414 N NEWLAND AVE	N/A	N	N	1928	1928	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4415 N NATCHEZ AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4415 N NEENAH AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4415 N NEW ENGLAND AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4415 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4415 N SAYRE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4416 N NAGLE AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4416 N NATCHEZ AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4416 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2005	N			N/A	N/A
4417 N NAGLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4417 N NASHVILLE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4417 N NATCHEZ AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4417 N NEENAH AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4417 N SAYRE AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4418 N NAGLE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4418 N NARRAGANSETT AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4418 N NEENAH AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4418 N NEWCASTLE AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4418 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4419 N NAGLE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4419 N NASHVILLE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4419 N NEW ENGLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4419 N NEWLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4420 N NATCHEZ AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4420 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4420 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4420 N NEWLAND AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4421 N NAGLE AVE	N/A	N	N	1922	1922	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4421 N NATCHEZ AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4421 N NEENAH AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4422 N NEENAH AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4422 N OAK PARK AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4423 N NASHVILLE AVE	N/A	N	N	1928	1928	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4423 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4423 N NEWCASTLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4423 N SAYRE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NAGLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NARRAGANSETT AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NATCHEZ AVE	N/A	N	N	1922	1922	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4424 N NEWLAND AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4425 N NAGLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4425 N NATCHEZ AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4425 N NEENAH AVE	N/A	N	N	1994	1994	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4425 N NEWLAND AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150-day notification, if customer refused access to property
4425 N SAYRE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N NAGLE AVE	N/A	N	N	1935	1935	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N NEENAH AVE	N/A	N	N	1935	1935	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N NEW ENGLAND AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N NEWCASTLE AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N NEWLAND AVE	N/A	N	N	1982	1982	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4426 N OAK PARK AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4427 N NAGLE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4427 N NEWCASTLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4427 N NEWLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4428 N NAGLE AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4428 N NARRAGANSETT AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4428 N NATCHEZ AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4428 N NEWCASTLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4429 N NATCHEZ AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4429 N NEENAH AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4429 N SAYRE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4430 N NARRAGANSETT AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4430 N NATCHEZ AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4430 N NEW ENGLAND AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4430 N NEWLAND AVE	N/A	N	N	1933	1933	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4430 N OAK PARK AVE	N/A	N	N	1993	1993	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NAGLE AVE	N/A	N	N	1924	1924	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NATCHEZ AVE	N/A	N	N	1918	1918	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NEENAH AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NEW ENGLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NEWCASTLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N NEWLAND AVE	N/A	N	N	1928	1928	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4431 N SAYRE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4432 N NAGLE AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4432 N NARRAGANSETT AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4432 N NATCHEZ AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4433 N NEWCASTLE AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4433 N NAGLE AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4433 N NATCHEZ AVE	N/A	N	N	1912	1912	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4433 N NEENAH AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4433 N NEW ENGLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4434 N NARRAGANSETT AVE	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4434 N NEWLAND AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4434 N OAK PARK AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4435 N NATCHEZ AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4435 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4435 N NEWCASTLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4435 N NEWLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4435 N SAYRE AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4436 N NATCHEZ AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4436 N NEW ENGLAND AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4436 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4436 N NEWLAND AVE	N/A	N	N	1993	1993	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4437 N NAGLE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4437 N NATCHEZ AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4437 N NEW ENGLAND AVE	N/A	N	Y	1955	1955	Maintenance Records	L	L	L	L	N		N			N/A	N/A
4437 N NEWLAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4437 N SAYRE AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N NAGLE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N NATCHEZ AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N NEWCASTLE AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N NEWLAND AVE	N/A	N	N	2018	2018	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4438 N OAK PARK AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4439 N NAGLE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4439 N NEW ENGLAND AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4439 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4439 N NEWLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4439 N SAYRE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4440 N NARRAGANSETT AVE	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4440 N NATCHEZ AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4440 N NEW ENGLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4440 N NEWLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4441 N NAGLE AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4441 N NATCHEZ AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4441 N NEW ENGLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4441 N NEWLAND AVE	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4442 N NAGLE AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4442 N NEW ENGLAND AVE	N/A	N	N	1938	1938	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4442 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4442 N OAK PARK AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4443 N NEWCASTLE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4443 N NEWLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4444 N NARRAGANSETT AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4444 N NEW ENGLAND AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4444 N NEWLAND AVE	N/A	N	N	1926	1926	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4445 N NEW ENGLAND AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4445 N SAYRE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4446 N NEWCASTLE AVE	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4446 N OAK PARK AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4447 N NEWCASTLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4447 N SAYRE AVE	N/A	N	N	1938	1938	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4448 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4448 N NEW ENGLAND AVE	N/A	N	N	1999	1999	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4448 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4448 N NEWLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4449 N NEW ENGLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4449 N NEWLAND AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4449 N SAYRE AVE	N/A	N	N	2025	2025	Construction Records	C	C	C	NL	N	N/R	N			N/A	N/A
4450 N NEW ENGLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4450 N OAK PARK AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4451 N NEW ENGLAND AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4451 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4451 N SAYRE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4452 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4452 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4452 N NEWLAND AVE	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4453 N NEW ENGLAND AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4454 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4454 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4454 N NEWLAND AVE	N/A	N	N	2021	2021	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4455 N NEW ENGLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4455 N NEWCASTLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4455 N NEWLAND AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4455 N SAYRE AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4456 N NEWCASTLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4457 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4457 N NEWCASTLE AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4457 N SAYRE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4458 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4458 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4458 N NEWLAND AVE	N/A	N	N	1978	1978	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4459 N NEWCASTLE AVE	N/A	N	N	1978	1978	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4459 N NEWLAND AVE	N/A	N	N	1933	1933	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
4500 N NEW ENGLAND AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4500 N NEWLAND AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4500 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4501 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4501 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4501 N NEWLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4501 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4502 N NEW ENGLAND AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4502 N NEWCASTLE AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4502 N NEWLAND AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4502 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4503 N NEW ENGLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4503 N NEWCASTLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4503 N NEWLAND AVE	N/A	N	N	2009	2009	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4503 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4504 N NARRAGANSETT AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4505 N NEW ENGLAND AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4505 N NEWCASTLE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4505 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4506 N NARRAGANSETT AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4506 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4506 N NEWLAND AVE	N/A	N	N	1982	1982	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4506 N N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4507 N NEW ENGLAND AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4507 N NEWCASTLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4508 N NEW ENGLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4508 N NEWCASTLE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4509 N NEWLAND AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4509 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4511 N NEWCASTLE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4511 N NEWLAND AVE	N/A	N	N	1997	1997	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4512 N NEW ENGLAND AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4512 N NEWCASTLE AVE	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4513 N SAYRE AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4514 N NEW ENGLAND AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4514 N NEWLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4515 N NEW ENGLAND AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	N	N	5/5/2025	N			N/A	N/A
4515 N NEWCASTLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4515 N NEWLAND AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4515 N SAYRE AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4516 N NEWLAND AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4516 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4517 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4517 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4517 N NEWLAND AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4517 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4518 N NEW ENGLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4518 N NEWLAND AVE	N/A	N	N	1999	1999	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4518 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4519 N NEW ENGLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4519 N NEWLAND AVE	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4519 N SAYRE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4520 N NEW ENGLAND AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4520 N NEWCASTLE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4520 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4521 N NEWCASTLE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4521 N SAYRE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4522 N NEWCASTLE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4522 N NEWLAND AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4522 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4523 N NEW ENGLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4523 N NEWCASTLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4523 N NEWLAND AVE	N/A	N	N	1997	1997	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4524 N NEWCASTLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4524 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4525 N NEW ENGLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4525 N NEWCASTLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4525 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4525 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4526 N NEW ENGLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4526 N NEWCASTLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4526 N NEWLAND AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4526 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4527 N NEWCASTLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4528 N NARRAGANSETT AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4528 N NEW ENGLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4528 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4528 N NEW ENGLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4529 N NEW ENGLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4529 N NEWLAND AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4529 N SAYRE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4530 N NARRAGANSETT AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4530 N NEW ENGLAND AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4530 N NEWLAND AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4531 N NEW ENGLAND AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4531 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4531 N NEWLAND AVE	N/A	N	N	1935	1935	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4531 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4532 N NARRAGANSETT AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4532 N NEW ENGLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4533 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4534 N NARRAGANSETT AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4534 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4534 N NEWLAND AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4535 N NEWCASTLE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4535 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4536 N NEW ENGLAND AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4536 N NEWCASTLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4536 N NEWLAND AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4537 N NEWLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4537 N SAYRE AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4538 N HARBEM AVE	N/A	N	N	1976	1976	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4539 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4539 N NEWLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4540 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4540 N NEW ENGLAND AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4540 N NEWCASTLE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4540 N NEWLAND AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4541 N NEW ENGLAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4541 N NEWCASTLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4541 N NEWLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4541 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4542 N NEW ENGLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4542 N NEWCASTLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4542 N NEWLAND AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4542 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4543 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4543 N NEWCASTLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4543 N SAYRE AVE	N/A	N	N	2019	2019	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4544 N NEW ENGLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4545 N NEW ENGLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4545 N NEWCASTLE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4545 N SAYRE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4545 N NEWCASTLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4546 N NEWLAND AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4546 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4547 N NEWCASTLE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4547 N NEWLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4548 N HARLEM AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4548 N NEW ENGLAND AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4548 N NEWCASTLE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4548 N NEWLAND AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4548 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4549 N NEW ENGLAND AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4549 N NEWCASTLE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4549 N NEWLAND AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4549 N SAYRE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4550 N NAGLE AVE	LC11024	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4550 N NEW ENGLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4550 N NEWCASTLE AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4550 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4551 N NEW ENGLAND AVE	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4551 N NEWCASTLE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4551 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4552 N NEWLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4552 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4553 N NEWLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4553 N SAYRE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4554 N NAGLE AVE	LC11025	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4554 N NEW ENGLAND AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4554 N NEWCASTLE AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4554 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4555 N NAGLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4555 N NEW ENGLAND AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4555 N NEWCASTLE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4555 N SAYRE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4556 N NEWCASTLE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4556 N NEWLAND AVE	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4557 N NEWLAND AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4558 N NAGLE AVE	LC11026	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4558 N NEWLAND AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4559 N NEW ENGLAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4559 N NEWLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4560 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4564 N NAGLE AVE	N/A	N	N	1903	1903	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4566 N NAGLE AVE	N/A	N	N	1979	1979	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4570 N NARRAGANSETT AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4572 N NARRAGANSETT AVE	N/A	N	N	1929	1929	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4574 N NARRAGANSETT AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4575 N NAGLE AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4576 N NARRAGANSETT AVE	LC11034	N	N	1946	1946	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4600 N HARLEM AVE	N/A	N	N	1979	1979	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N NEW ENGLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4600 N NEWLAND AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4600 N OAK PARK AVE	N/A	N	N	2025	2025	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N OAK PARK AVE	N/A	N	N	2014	2014	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N OAK PARK AVE	N/A	N	N	2015	2015	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N OLCOTT AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4600 N OLCOTT AVE	N/A	N	N	1960	1960	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N RONALD ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4600 N RONALD ST	N/A	N	N	1965	1965	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4600 N SAYRE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4602 N NEWLAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4601 N RONALD ST	N/A	N	N	1957	1957	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4601 N RONALD ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4601 N SAYRE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4604 N NEW ENGLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4604 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4604 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4605 N NEWLAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4605 N SAYRE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4608 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4608 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4608 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4609 N RONALD ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4609 N SAYRE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4610 N RONALD ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4610 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4611 N OLCOTT AVE	N/A	N	N	1963	1963	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4612 N NEW ENGLAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4612 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4612 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4613 N NEWLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4613 N OXTO AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4614 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4615 N NEWLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4615 N RONALD ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4615 N SAYRE AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4616 N SAYRE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4617 N NEWLAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4617 N SAYRE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4618 N NEWLAND AVE	N/A	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4619 N NAGLE AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	NL	N	5/6/2025	N			N/A	N/A
4619 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4620 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4620 N NEW ENGLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4620 N NEWLAND AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4620 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4620 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4621 N SAYRE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4622 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4622 N NEWLAND AVE	N/A	N	N	1959	1959	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4624 N NEW ENGLAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4624 N NEWLAND AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4624 N OXTO AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4624 N SAYRE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4625 N NEWLAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4625 N RONALD ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4625 N SAYRE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4626 N NARRAGANSETT AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4626 N OLCOTT AVE	N/A	N	N	1960	1960	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4626 N NAGLE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4627 N NEWLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4628 N NEW ENGLAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4628 N SAYRE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4629 N NAGLE AVE	LCT1027	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4629 N NEWLAND AVE	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4629 N RONALD ST	N/A	N	N	2001	2001	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4629 N SAYRE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4630 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
4630 N RONALD ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4631 N SAYRE AVE	N/A	N	N	1986	1986	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4632 N NEW ENGLAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4632 N NEWLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4632 N SAYRE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4633 N NEWLAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4633 N OLCOTT AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4633 N SAYRE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4634 N NARRAGANSETT AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4634 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4635 N NAGLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4635 N NEWLAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4635 N OLCOTT AVE	N/A	N	Y	1986	1986	Visual Inspection	C	C	C	NL	N	N/R	N			N/A	N/A
4635 N SAYRE AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4636 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4636 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4637 N NEWLAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4637 N SAYRE AVE	N/A	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4638 N NARRAGANSETT AVE	LCT1039	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4638 N NEW ENGLAND AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4639 N NEWLAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4639 N RONALD ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4639 N RONALD ST	N/A	N	N	1966	1966	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4639 N SAYRE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4640 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4640 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4640 N OLCOTT AVE	N/A	N	N	1961	1961	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4640 N OLCOTT AVE	N/A	N	N	1959	1959	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4640 N RONALD ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4640 N SAYRE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4641 N NAGLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4642 N NARRAGANSETT AVE	N/A	N	Y	1952	1952		U	U	U	U	N		N			N/A	N/A
4642 N NEW ENGLAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4644 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4644 N OAK PARK AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4644 N SAYRE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4645 N NAGLE AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4646 N NARRAGANSETT AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4646 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4647 N NEWLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4648 N OAK PARK AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4648 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4650 N OAK PARK AVE	N/A	N	N	1919	1919	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4650 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4650 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4651 N NAGLE AVE	LCT1028	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4652 N NARRAGANSETT AVE	N/A	N	N	2015	2015	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4652 N OLCOTT AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4652 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4655 N NAGLE AVE	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4656 N NARRAGANSETT AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4656 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4659 N NAGLE AVE	LCT1029	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4660 N HARLEM AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4660 N OAK PARK AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4660 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4662 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4663 N NAGLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4665 N NAGLE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4668 N NARRAGANSETT AVE	LCT1036	N	N	1954	1954	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
4672 N NARRAGANSETT AVE	LC1056	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4700 N HARLEM AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4700 N NEW ENGLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N OAK PARK AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N OCONTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N OCTAVIA AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N ODELL AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4700 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4700 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N HARLEM AVE	N/A	N	N	1984	1984	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4701 N NAGLE AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4701 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N OCONTO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N ODELL AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N ORETO AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N OLCOTT AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N RONALD ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4701 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4702 N OCONTO AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4702 N OCTAVIA AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4702 N ODELL AVE	N/A	N	N	1997	1997	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4702 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4703 N NAGLE AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4703 N OCONTO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4703 N OCTAVIA AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4703 N ODELL AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4703 N ORETO AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4704 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N OAK PARK AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N OCONTO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N OCTAVIA AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N ODELL AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4704 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N NAGLE AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4705 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N NEWCASTLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N NEWLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N OCONTO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N ODELL AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4705 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4706 N OCONTO AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4706 N OCTAVIA AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4706 N ODELL AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4706 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4707 N OCONTO AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4707 N OCTAVIA AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4707 N ODELL AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4707 N ORETO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4708 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4708 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N OAK PARK AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N OCONTO AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N OCTAVIA AVE	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N ODELL AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4708 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N NAGLE AVE	LC11030	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4709 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N NEWCASTLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N OCONTO AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N OCTAVIA AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N ODELL AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4709 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4710 N OCONTO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4710 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4710 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4711 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4711 N OCTAVIA AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4711 N ODELL AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4711 N OKEO AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N NAMMAGANNETT AVE	LC11037	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4712 N NEWCASTLE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N OAK PARK AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N OCONTO AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4712 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N NAGLE AVE	LC11031	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4713 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N OKEO AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4713 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4714 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4714 N OCTAVIA AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4714 N ODELL AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4714 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4714 U2 OGDON	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4715 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4715 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4715 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4715 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4715 N RONALD ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N HABLEM AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N OCTAVIA AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4716 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N ODELL AVE	N/A	N	N	1991	1991	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N OKEO AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4717 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4718 N NAMMAGANNETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4718 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4718 N OCTAVIA AVE	N/A	N	N	1957	1957	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4718 N ODELL AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4718 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4719 N NAGLE AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4719 N OCONTO AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4719 N OCTAVIA AVE	N/A	N	N	1960	1960	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4719 N OKETO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4720 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4720 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4720 N OCONTO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4720 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4720 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N NEW ENGLAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N OCONTO AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N ODELL AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4721 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4722 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4722 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4722 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4722 N ODELL AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4722 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4723 N NAGLE AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4723 N OCONTO AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4723 N OCTAVIA AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4723 N OKETO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N OCONTO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4724 N SAYRE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N NEW ENGLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4725 N WASHINGTON	N/A			Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4726 N NARRAGANSETT AVE	LCT1028	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4726 N ODELL AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4726 N OLCOTT AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4727 N NAGLE AVE	N/A	N	N	1954	1954	Visual Inspection	C	C	C	NL	N	N/R	N			N/A	N/A
4727 N NEWCASTLE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4727 N OCTAVIA AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4727 N OKETO AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N NEWLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4728 N SAYRE AVE	N/A	N	N	1981	1981	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4729 N NEW ENGLAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4729 N NEWLAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4729 N OCTAVIA AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4729 N ODELL AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4729 N SAYRE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4730 N NARRAGANSETT AVE	LCT1054	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
4730 N ODELL AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4731 N NAGLE AVE	LC17032	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4732 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N OHETO AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N HARLEM AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N OAK PARK AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4732 N SAYRE AVE	N/A	N	N	1985	1985	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N NEW ENGLAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N NEWLAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N OCTAVIA AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N ODELL AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4733 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4734 N HARLEM AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4735 N OCTAVIA AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4735 N OHETO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N HARLEM AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N OAK PARK AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N OCONTO AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N OCTAVIA AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N ODELL AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4736 N SAYRE AVE	N/A	N	N	1932	1932	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4737 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4737 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4737 N OCTAVIA AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4737 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4738 N HARLEM AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4738 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4739 N NAGLE AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4739 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4739 N OHETO AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N HARLEM AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N NEW ENGLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N OAK PARK AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4740 N OLCOTT AVE	N/A	N	N	1966	1966	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4740 N SAYRE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4741 N NEW ENGLAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4741 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4741 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4741 N OHETO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4741 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4742 N HARLEM AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4742 N NARRAGANSETT AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4742 N NEW ENGLAND AVE	N/A	N	N	1995	1995	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4742 N OAK PARK AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4742 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4743 N NAGLE AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/5/2025	N			N/A	N/A
4744 N NEW ENGLAND AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4744 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4744 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4744 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4744 N SAYRE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4745 N NEWLAND AVE	N/A	N	N	1962	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4745 N SAYRE AVE	N/A	N	N	1962	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4746 N NARRAGANSETT AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4746 N NEW ENGLAND AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4746 N OAK PARK AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4746 N ODELL AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4747 N HARLEM AVE	N/A	N	N	1988	1988	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4747-2 N HARLEM AVE	N/A	N	N	2015	2015	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4747 N NAGLE AVE	LC17019	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4747 N NEW ENGLAND AVE		N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4747 N NEWCASTLE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4747 N RONALD ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N NEW ENGLAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N NEWCASTLE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N OAK PARK AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4748 N SAYRE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4749 N NEW ENGLAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4749 N NEWLAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4749 N SAYRE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4750 N HARLEM AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4750 N NARRAGANSETT AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4750 N OAK PARK AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4750 N RONALD ST	N/A	N	N	2003	2003	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4751 N HARLEM AVE	N/A	N	N	1964	1964	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4751 N NAGLE AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4751 N NEW ENGLAND AVE	N/A	N	N	2001	2001	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4751 N OLCOTT AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4752 N NEW ENGLAND AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4752 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4752 N OLCOTT AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4753 N NEWLAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4753 N SAYRE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4757 N RONALD ST	N/A	N	N	1958	1958	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4765 N NEW ENGLAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4770 N NEW ENGLAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4770 N NEWCASTLE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4771 N NEWCASTLE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4800 N HARLEM AVE	N/A	N	N	1997	1997	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4800 N NAGLE AVE	N/A	N	N	2016	2016	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4802 N RUTHERFORD AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4807 N NORMANDY AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4809 N NEW ENGLAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4811 N OLCOTT AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4820 N HARLEM AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4830 N ODELL CT	N/A	N	N	2001	2001	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4831 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4831 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4833 N OLCOTT AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4833 N ORIOLE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4834 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4835 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4835 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4835 N ORIOLE AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4838 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4839 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4839 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4842 N ODELL CT	N/A	N	N	2001	2001	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150-day notification, if customer refused access to property
4843 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4843 N OKETO AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4846 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4847 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4847 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4850 N HARLEM AVE	N/A	N	N	1987	1987	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4850 N HARLEM AVE	N/A	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4850 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4851 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4851 N OKETO AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4854 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4855 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4855 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4857 N ORIOLE AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4858 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4859 N ODELL CT	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4859 N OKETO AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4859 N ORIOLE AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4861 N ORIOLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4861 N ORIOLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4865 N ORIOLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4867 N ORIOLE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4900 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4900 N OKONTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4900 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4900 N ODELL AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4901 N OKONTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4901 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4901 N OKETO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4901 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4903 N OKONTO AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4904 N HARLEM AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4904 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4905 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4906 N OKONTO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4907 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4907 N OKETO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4908 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4908 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4908 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4909 N ODELL AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4909 N ORIOLE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4910 N OKONTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4910 N ODELL AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4911 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4911 N OKETO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4912 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4912 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4913 N ORIOLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4915 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4915 N OKETO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4916 N HARLEM AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4916 N OKONTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4916 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4917 N OKONTO AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4917 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4917 N ORIOLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4919 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4919 N OKETO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4920 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submittal Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service was Installed	Source of Information Used for Service Line Identification	Gonnesbeck/ Piggitt	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material Used downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer waiver or 10-year release, if customer refused access to property
4930 N OCONTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4930 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4930 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4931 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4933 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4933 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4933 N OCKTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4934 N OCKTO AVE	N	N	N	1983	1983	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4934 N OCONTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4934 N OCTAVIA AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4935 N OCONTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4935 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4935 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N OCONTO AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4938 N HARLEM AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4938 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCTAVIA AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCKTO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCKTO AVE	N	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCONTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N ODELL AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCONTO AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N OCONTO AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N OCKTO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4937 N ORIOLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N OCONTO AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N ODELL AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4939 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4940 N OCTAVIA AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4940 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4941 N OCONTO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4941 N OCKTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4941 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4942 N ODELL AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4943 N ODELL AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4943 N ORIOLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4944 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4945 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4945 N ODELL AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4945 N OCKTO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4945 N OCTAVIA AVE	N	N	N	1982	1982	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4947 N OCONTO AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4947 N OCTAVIA AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4948 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4950 N HARLEM AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4951 N OCKTO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4952 N ODELL AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4953 N OCKTO AVE	N	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4955 N ODELL AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4955 N ORIOLE AVE	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
4956 N ODELL AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4957 N OCONTO AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4957 N ONETO AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
4958 N OCTAVIA AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4959 N ODELL AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4960 N OCONTO AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4960 N ODELL AVE	N/A	N	N	2015	2015	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4962 N OCONTO AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4970 N HARLEM AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
4970 N HARLEM AVE	N/A	N	N	1965	1965	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
4986 N OCONTO AVE	N/A	N	N	2022	2022	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5000 N OCONTO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5000 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5001 N OCTAVIA AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5001 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5001 N ONETO AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5001 N OLCOTT AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5001 N ORIOLE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5009 N ORIOLE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5009 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5009 N ODELL AVE	N/A	N	N	1962	1962	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5007 N ORIOLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5009 N ORIOLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5010 N OCTAVIA AVE	N/A	N	Y	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	Y	8/22/2023	C	N/A	N/A
5011 N OCTAVIA AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5011 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5012 N ODELL AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5013 N ORIOLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5015 N OCONTO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5015 N ODELL AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5015 N ONETO AVE	LCT1039	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5016 N OCONTO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5016 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5019 N ODELL AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5019 N ONETO AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5020 N OCONTO AVE	N/A	N	N	1954	1954	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5020 N OCTAVIA AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5021 N OCONTO AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5021 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5021 N ORIOLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5022 N HARLEM AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5022 N ODELL AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5023 N ORIOLE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5023 N OCONTO AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5024 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5025 N OCONTO AVE	N/A	N	Y	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	Y	2/6/2025	C	N/A	N/A
5025 N ONETO AVE	N/A	N	Y	1952	1952	Visual Inspection	L	L	L	L	N	9/24/2025	N			N/A	N/A
5025 N ORIOLE AVE	N/A	N	N	2025	2025	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5026 N OCONTO AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5027 N OCONTO AVE	N/A	N	Y	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	Y	12/7/2022	C	N/A	N/A
5027 N OCTAVIA AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5028 N ODELL AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5029 N OCONTO AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5030 N OCTAVIA AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5031 N OCONTO AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5031 N ODELL AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5031 N ONETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5031 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5031 N OCONTO AVE	LCT1001	N	N	1957	1957	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5033 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
5034 N ODELL AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5035 N OCONTO AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5035 N OCTAVIA AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5035 N ODELL AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5036 N ORIOLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5036 N OCTAVIA AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5037 N OHIO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5037 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5038 N OCONTO AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5039 N OCTAVIA AVE	N/A	N	N	1952	1952	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
5039 N ODELL AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5039 N ORIOLE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5040 N ODELL AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5041 N OCTAVIA AVE	N/A	N	N	2024	2024	Construction Records	C	C	C	NL	N	N/R	N			N/A	N/A
5041 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5041 N OHIO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5041 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5041 N OCTAVIA AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5043 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5044 N OCONTO AVE	LCT1002	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5044 N OCTAVIA AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5044 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5045 N OCONTO AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5045 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5045 N ORIOLE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5046 N OCONTO AVE	LCT1003	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5046 N OCTAVIA AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5047 N OCTAVIA AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5047 N ORIOLE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5048 N OCTAVIA AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5048 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5049 N OCTAVIA AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5049 N ODELL AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5049 N OHIO AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5049 N ORIOLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5050 N HARLEM AVE	N/A	N	N	2022	2022	Construction Records	O	O	O	NL	N	N/R	N			N/A	N/A
5050 N OCONTO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5050 N OCTAVIA AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5051 N OHIO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5053 N OCONTO AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5053 N OCTAVIA AVE	N/A	N	N	1945	1945	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5053 N ODELL AVE	N/A	N	Y	1942	1942	Visual Inspection	L	L	L	L	N	9/24/2025	N			N/A	N/A
5054 N OCONTO AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5054 N OCTAVIA AVE	N/A	N	Y	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	Y	10/6/2017	C	N/A	N/A
5054 N ODELL AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5057 N OCTAVIA AVE	N/A	N	N	1945	1945	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5057 N ODELL AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5058 N OCONTO AVE	LCT1004	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5058 N OCTAVIA AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5058 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5059 N OCONTO AVE	LCT1005	N	N	1944	1944	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5059 N OHIO AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5101 N OCONTO AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5101 N ORIOLE AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5102 N OCONTO AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5102 N OCTAVIA AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5102 N ODELL AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5103 N OCTAVIA AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5103 N ODELL AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5103 N OHIO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
5103 N ORIOLE AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5105 N ORIOLE AVE	N/A	N	N	1956	1956	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
5107 N OCONTO AVE	N/A	N	Y	1940	1940		U	U	U	U	N		N			N/A	N/A
5108 N OCONTO AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5108 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5108 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5109 N OCTAVIA AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5109 N ODELL AVE	N/A	N	N	1944	1944	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5109 N ORETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5109 N ORIOLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5111 N ODELL AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5112 N OCONTO AVE	LC17006	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5113 N OCONTO AVE	LC17010	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5114 N OCTAVIA AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5114 N ODELL AVE	N/A	N	N	1944	1944	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5115 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5115 N ODELL AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5115 N ORETO AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5115 N ORIOLE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5116 N HARLEM AVE	N/A	N	N	1976	1976	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
5117 N OCONTO AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5118 N OCONTO AVE	LC17007	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5118 N OCTAVIA AVE	N/A	N	Y	1943	1943	Visual Inspection	L	L	L	L	N	9/26/2025	N			N/A	N/A
5118 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5119 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5119 N ORETO AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5119 N ODELL AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5119 N ORIOLE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5121 N OCONTO AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5121 N OCTAVIA AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5121 N ODELL AVE	LC17013	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5121 N ORETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5121 N ORIOLE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5122 N OCONTO AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5122 N OCTAVIA AVE	N/A	N	N	1940	1940	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5122 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5124 N HARLEM AVE	N/A	N	N	1977	1977	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
5124 N OCTAVIA AVE	N/A	N	N	1942	1942	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5124 N ODELL AVE	LC17014	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5125 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5125 N ORETO AVE	LC17015	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5125 N ORETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5126 N OCONTO AVE	LC17011	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5127 N OCONTO AVE	LC17009	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5127 N ORIOLE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5128 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5128 N ODELL AVE	LC17016	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5129 N OCTAVIA AVE	N/A	N	N	1942	1942	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5129 N ORETO AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5129 N ORETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5130 N OCONTO AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5132 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5132 N ODELL AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5133 N OCONTO AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5133 N OCTAVIA AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5133 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5133 N ORETO AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5135 N ORIOLE AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5136 N OCONTO AVE	N/A	N	Y	1939	1939	Maintenance Records	L	L	L	L	N		N			N/A	N/A
5136 N OCTAVIA AVE	N/A	N	N	1940	1940	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
5136 N ODELL AVE	N/A	N	Y	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	Y	10/31/2012	C	N/A	N/A
5137 N OCANTO AVE	N/A	N	N	2005	2005	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5137 N OCTAVIA AVE	N/A	N	N	1940	1940	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5137 N ODELL AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5137 N OKETO AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5140 N OCTAVIA AVE	N/A	N	N	1940	1940	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5140 N ODELL AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5141 N OCANTO AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5141 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5141 N ODELL AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5141 N OKETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5142 N OCANTO AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5143 N ODELL AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5143 N OKETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5144 N OCTAVIA AVE	N/A	N	N	1942	1942	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5144 N ODELL AVE	LC11008	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5145 N OCANTO AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5145 N OCTAVIA AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5146 N OCANTO AVE	LC11012	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
5147 N OKETO AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5148 N HARKLEM AVE	N/A	N	N	1974	1974	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5148 N OKETO AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5150 N OKETO AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
5152 N OKETO AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6125 W GUNNISON ST	N/A	N	N	1978	1978	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6125 W GUNNISON ST	N/A	N	N	1978	1978	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6127 W GUNNISON ST	N/A	N	N	1978	1978	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6400 W MONTROSE AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6413 W SUNNYSIDE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6415 W SUNNYSIDE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6416 W SUNNYSIDE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6417 W SUNNYSIDE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6418 W SUNNYSIDE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6419 W FOREST PRESERVE DR	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6420 W SUNNYSIDE AVE	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6422 W FOREST PRESERVE DR	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6422 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6423 W FOREST PRESERVE DR	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6424 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6424 W SUNNYSIDE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6425 W SUNNYSIDE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6425 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6427 W FOREST PRESERVE DR	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6428 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6430 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6431 W FOREST PRESERVE DR	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6432 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6434 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6435 W FOREST PRESERVE DR	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6436 W MONTROSE AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6437 W SUNNYSIDE AVE	N/A	N	N	1945	1945	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6438 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6439 W FOREST PRESERVE DR	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6439 W SUNNYSIDE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6440 W MONTROSE AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6441 W FOREST PRESERVE DR	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6441 W SUNNYSIDE AVE	N/A	N	N	1942	1942	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6442 W MONTROSE AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6443 W FOREST PRESERVE DR	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6443 W SUNNYSIDE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
6444 W MONTROSE AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6445 W FOREST PRESERVE DR	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6445 W SUNNYSIDE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6445 W MONTROSE AVE	N/A	Y	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6447 W SUNNYSIDE AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6449 W SUNNYSIDE AVE	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6450 W MONTROSE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6451 W FOREST PRESERVE DR	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6451 W SUNNYSIDE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6451 W MONTROSE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6453 W FOREST PRESERVE DR	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6453 W SUNNYSIDE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6454 W MONTROSE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6500 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6500 W MONTROSE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6503 W SUNNYSIDE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6504 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6505 W FOREST PRESERVE DR	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6505 W SUNNYSIDE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6506 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6506 W MONTROSE AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6507 W FOREST PRESERVE DR	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6507 W SUNNYSIDE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6508 W GUNNISON ST	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6508 W MONTROSE AVE	N/A	N	N	1920	1920	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6509 W SUNNYSIDE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6510 W MONTROSE AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6511 W FOREST PRESERVE DR	N/A	N	N	1934	1934	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6512 W GUNNISON ST	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6514 W MONTROSE AVE	N/A	N	N	1928	1928	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6515 W FOREST PRESERVE DR	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6516 W MONTROSE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6517 W FOREST PRESERVE DR	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6518 W MONTROSE AVE	N/A	N	N	1979	1979	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6519 W FOREST PRESERVE DR	N/A	N	N	1983	1983	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6520 W GUNNISON ST	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6521 W FOREST PRESERVE DR	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6522 W MONTROSE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6528 W MONTROSE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6530 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6534 W GUNNISON ST	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6536 W MONTROSE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6536 W GUNNISON ST	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6539 W FOREST PRESERVE DR	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6541 W FOREST PRESERVE DR	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6542 W MONTROSE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6543 W FOREST PRESERVE DR	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6544 W MONTROSE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6546 W MONTROSE AVE	N/A	N	N	1930	1930	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6550 W GUNNISON ST	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6550 W MONTROSE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6556 W MONTROSE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6558 W MONTROSE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6567 W FOREST PRESERVE DR	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6600 W GUNNISON ST	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6600 W MONTROSE AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6601 W MONTROSE CT	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6602 W MONTROSE AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6604 W MONTROSE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6605 W FOREST PRESERVE DR	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
6609 W FOREST PRESERVE DR	N/A	N	N	1933	1933	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6610 W MONTROSE AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6612 W NORWOOD CT	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6615 W FOREST PRESERVE DR	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6615 1/2 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6616 W MONTROSE AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6618 W MONTROSE AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6620 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6620 W MONTROSE AVE	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6621 W NORWOOD CT	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6622 W MONTROSE AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6630 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6630 W MONTROSE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6632 W GUNNISON ST	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6634 W GUNNISON ST	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6635 W NORWOOD CT	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6636 W GUNNISON ST	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6638 W MONTROSE AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6640 W GUNNISON ST	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6650 W MONTROSE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6656 W MONTROSE AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6660 W MONTROSE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6662 W MONTROSE AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6664 W MONTROSE AVE	N/A	N	Y	1967	1967		U	U	U	U	N		N			N/A	N/A
6666 W MONTROSE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6667 W MONTROSE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6669 W MONTROSE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6670 W MONTROSE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6671 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6672 W MONTROSE AVE	N/A	N	N	2025	2025	Construction Records	C	C	C	NL	N	N/R	N			N/A	N/A
6673 W MONTROSE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6674 W MONTROSE AVE	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6675 W MONTROSE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6677 W MONTROSE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6678 W MONTROSE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6679 W MONTROSE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6689 W MONTROSE AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6700 W FOREST PRESERVE DR	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6700 W GUNNISON ST	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6701 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6703 W MONTROSE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6704 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6705 W MONTROSE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6708 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6709 W MONTROSE AVE	N/A	N	N	1959	1959	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
6710 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6713 W MONTROSE AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6716 W SENIOR PL	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6717 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6718 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6718 W SENIOR PL	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6719 W MONTROSE AVE	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6720 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6720 W SENIOR PL	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6721 W MONTROSE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6721 W SENIOR PL	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6723 W MONTROSE AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6724 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6724 W SENIOR PL	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6725 W MONTROSE AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
6726 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6726 W SENIOR PL	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6729 W SENIOR PL	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6730 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6730 W SENIOR PL	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6731 W SENIOR PL	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6732 W SENIOR PL	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6734 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6736 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6736 W SENIOR PL	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6738 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6738 W SENIOR PL	N/A	N	N	1931	1931	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6739 W MONTROSE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6740 W GUNNISON ST	N/A	N	N	1932	1932	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6740 W MONTROSE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6742 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6743 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6744 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6744 W MONTROSE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6746 W GUNNISON ST	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6747 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6749 W MONTROSE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6750 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6750 W GUNNISON ST	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6753 W MONTROSE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6754 W GUNNISON ST	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6760 W GUNNISON ST	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6764 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6764 W GUNNISON ST	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6772 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6774 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6775 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6778 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6780 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6800 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6800 W GUNNISON ST	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6800 W MONTROSE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6801 W MONTROSE AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6801 W SUNNYSIDE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6804 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6804 W GUNNISON ST	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6805 W MONTROSE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6808 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6809 W LELAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6809 W MONTROSE AVE	N/A	N	N	2016	2016	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6810 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6810 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6811 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6812 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6813 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6814 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6814 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6817 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6818 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6818 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6819 W MONTROSE AVE	N/A	N	N	1972	1972	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6821 W LELAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6822 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6823 W GUNNISON ST	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6825 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
6826 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6829 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6830 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6831 W MONTROSE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6832 W GUNNISON ST	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6833 W MONTROSE AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6833 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6834 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6837 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6838 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6839 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6839 W MONTROSE AVE	N/A	N	N	1973	1973	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6840 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6840 W GUNNISON ST	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6841 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6841 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2005	N			N/A	N/A
6842 W GUNNISON ST	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6842 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6843 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6844 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6844 W GUNNISON ST	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6845 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6846 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6847 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6848 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6848 W GUNNISON ST	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6848 W MONTROSE AVE	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6849 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6849 W MONTROSE AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6850 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6850 W MONTROSE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6851 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6851 W MONTROSE AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6852 W MONTROSE AVE	N/A	N	N	1933	1933	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6853 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6855 W MONTROSE AVE	N/A	N	N	1923	1923	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6856 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6856 W MONTROSE AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6857 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6858 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6860 Forest Preserve Dr	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6860 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6860 W MONTROSE AVE	N/A	N	N	1996	1996	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6861 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6862 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6864 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6866 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6900 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6900 W GUNNISON ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6900 W MONTROSE AVE	N/A	N	N	1895	1895	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6901 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6901 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6902 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6903 W GUNNISON ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6903 W MONTROSE AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6904 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6905 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6905 W MONTROSE AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6906 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6906 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
6906 W MONTROSE AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6907 W MONTROSE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6908 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6909 W LELAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6910 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6912 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6912 W MONTROSE AVE	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6913 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6913 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6914 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6915 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6916 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6916 W MONTROSE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6917 W LELAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6917 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6920 W FOREST PRESERVE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6920 W MONTROSE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6921 W LELAND AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6922 W MONTROSE AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6925 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6925 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6926 W MONTROSE AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6935 W GUNNISON ST	N/A	N	N	2018	2018	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
6936 W MONTROSE AVE	N/A	N	N	1998	1998	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6937 W LELAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6939 W MONTROSE AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6939 W MONTROSE AVE	N/A	N	N	1927	1927	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6940 W MONTROSE AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6941 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6941 W MONTROSE AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6942 W MONTROSE AVE	N/A	N	N	1992	1992	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6943 W MONTROSE AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6944 W MONTROSE AVE	N/A	N	N	1992	1992	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6945 W LELAND AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6947 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6949 W LELAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6949 W MONTROSE AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6950 W MONTROSE AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6951 W MONTROSE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6953 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6953 W MONTROSE AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6954 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6955 W MONTROSE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6955 W MONTROSE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6957 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6957 W MONTROSE AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6958 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6958 W MONTROSE AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6961 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
6965 W LELAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7005 W GUNNISON ST	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7005 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7005 W WILSON AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7101 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7105 W WILSON AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7105 W WILSON AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7125 W WILSON AVE	N/A	N	N	1965	1965	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7125 W GUNNISON ST	N/A	N	N	1968	1968	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7171 W GUNNISON ST	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7200 W WILSON AVE	N/A	N	N	1980	1980	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7211 W LELAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 100% notification, if customer refused access to property
7213 W LELAND AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7215 W FOSTER AVE	N/A	N	N	1940	1940	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7215 W LELAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7217 W LELAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7219 W LELAND AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7220 W WILSON AVE	N/A	N	N	1959	1959	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7221 W LELAND AVE	N/A	N	N	1936	1936	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7223 W ARGYLE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7223 W FOSTER AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7225 W LELAND AVE	N/A	N	N	1921	1921	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7227 W FOSTER AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7227 W LELAND AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7227 W WILSON AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7227 W FOSTER AVE	N/A	N	N	1970	1970	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7229 W FOSTER AVE	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7230 W WILSON AVE	N/A	N	N	1978	1978	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7231 W LELAND AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7235 W FOSTER AVE	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7239 W WILSON AVE	N/A	N	N	1957	1957	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7239 W WILSON AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7241 W FOSTER AVE	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7241 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7249 W LELAND AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7251 W LAWRENCE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7251 W LELAND AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7253 W LELAND AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7255 W ARGYLE ST	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7255 W FOSTER AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7255 W LELAND AVE	N/A	N	N	1987	1987	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7257 W LELAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7259 W LAWRENCE AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7259 W LELAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7260 W WILSON AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7301 W FOSTER AVE	N/A	N	N	1941	1941	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7303 W LELAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7303 W WILSON AVE	N/A	N	N	1956	1956	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7303 W LELAND AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7304 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7305 W FOSTER AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7305 W LELAND AVE	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7306 W LAWRENCE AVE	N/A	N	N	2017	2017	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7307 W LELAND AVE	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7309 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7309 W LELAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7310 W WILSON AVE	N/A	N	N	1962	1962	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7311 W FOSTER AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7311 W LELAND AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7315 W WILSON AVE	N/A	N	N	1955	1955	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7315 W WILSON AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7317 W LELAND AVE	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7319 W FOSTER AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7319 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7319 W WILSON AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7320 W ARGYLE ST	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7323 W FOSTER AVE	LCT020	N	N	1949	1949	Maintenance Records	L	L	G	L	N	5/6/2025	N			N/A	N/A
7323 W LELAND AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7325 W ARGYLE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7325 W LELAND AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7329 W ARGYLE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7330 W WILSON AVE	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
7333 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7333 W FOSTER AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7333 W WILSON AVE	N/A	N	N	1959	1959	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7336 W ARDYLE ST	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7337 W FOSTER AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7340 W ARDYLE ST	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7341 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7343 W FOSTER AVE	N/A	N	N	1943	1943	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7343 W LAWRENCE AVE	N/A	N	N	2015	2015	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7345 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7347 W FOSTER AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7349 W AINSLIE ST	N/A	N	N	2001	2001	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7350 W ARDYLE ST	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7353 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7353 W WILSON AVE	N/A	N	N	1956	1956	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7355 W FOSTER AVE	N/A	N	N	1947	1947	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7355 W LELAND AVE	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7355 W WILSON AVE	N/A	N	N	1956	1956	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7357 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7357 W LELAND AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7358 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7359 W LELAND AVE	N/A	N	N	1968	1968	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7361 W AINSLIE ST	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7361 W LELAND AVE	N/A	N	N	2019	2019	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7363 W LELAND AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7365 W LELAND AVE	N/A	N	N	2018	2018	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7369 W LELAND AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7371 W LELAND AVE	N/A	N	N	1988	1988	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7373 W LELAND AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7375 W LELAND AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7400 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7400 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	L	L	G	L	Y	5/6/2025	N			N/A	N/A
7400 W CARMEN AVE	LCT1017	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7400 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7400 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7400 W WILSON AVE	N/A	N	N	1959	1959	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7400 W WINONA ST	LCT1052	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7400 WINNEMAC AVE	LCT1040	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7401 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7401 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7401 W CARMEN AVE	LCT1036	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7402 W LAWRENCE AVE	N/A	N	N	2012	2012	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7401 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7401 W WILSON AVE	N/A	N	N	1958	1958	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7401 W WINONA ST	LCT1042	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7401 WINNEMAC AVE	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7404 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7404 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7404 W CARMEN AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7404 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7404 W WINONA ST	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7404 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7405 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7405 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7405 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7405 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7405 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7405 WINNEMAC AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7408 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7408 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
7408 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7408 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7408 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7408 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7409 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7409 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7409 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7409 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7409 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7409 WINNEMAC AVE	N/A	N	Y	1950	1950	Visual Inspection	L	L	L	L	N	5/23/2025	N			N/A	N/A
7411 W FOSTER AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7412 W AINSIE ST	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7412 W ARDYLE ST	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7412 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7412 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7412 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7412 WINNEMAC AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7413 W AINSIE ST	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7413 W ARDYLE ST	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7413 W CARMEN AVE	LC1209	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7413 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7413 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7415 W FOSTER AVE	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7416 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7416 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7416 W CARMEN AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7416 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7416 W WINONA ST	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7416 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7417 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7417 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7417 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7417 W STRONG ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7417 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7420 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7420 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7420 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7420 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7420 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7420 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7421 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7421 W ARDYLE ST	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7421 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7421 W FOSTER AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7421 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7421 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7421 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7424 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7424 W ARDYLE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7424 W CARMEN AVE	N/A	N	N	1956	1956	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7424 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7424 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7424 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7425 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7425 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	Y	5/6/2025	N			N/A	N/A
7425 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7425 W FOSTER AVE	LC1202	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7425 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7425 W WINONA ST	N/A	N	N	1955	1955	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7428 W AINSIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line No. identified Since last submitted inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
7428 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7428 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7428 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7428 W WINONA ST	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7428 WINNEMAC AVE	N/A	N	Y	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	Y	4/19/2024	C	N/A	N/A
7429 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7429 W ARDYLE ST	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7429 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7429 W FOSTER AVE	LC11022	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7429 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7429 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7429 WINNEMAC AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7432 W AINSLIE ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7432 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7432 W CARMEN AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7432 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7432 W WINONA ST	LC11043	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7432 WINNEMAC AVE	LC11041	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7433 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7433 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7433 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7433 W FOSTER AVE	LC11050	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7433 W STRONG ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7433 W WINONA ST	LC11053	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7435 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7435 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7435 W ARDYLE ST	N/A	N	N	1956	1956	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7435 W CARMEN AVE	N/A	N	Y	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	Y	6/5/2025	C	N/A	N/A
7435 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7435 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7435 WINNEMAC AVE	N/A	N	N	1956	1956	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7437 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7437 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7437 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7437 W FOSTER AVE	LC11051	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7437 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7437 W WINONA ST	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7440 W AINSLIE ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7440 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7440 W CARMEN AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7440 W STRONG ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7440 W WINONA ST	LC11048	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7440 WINNEMAC AVE	N/A	N	N	1950	1950	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7441 W AINSLIE ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7441 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7441 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7441 W FOSTER AVE	LC11049	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7441 W STRONG ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7441 W WINONA ST	LC11045	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7444 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7444 W ARDYLE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7444 W CARMEN AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7444 W STRONG ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7444 W WILSON AVE	N/A	N	N	1957	1957	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7444 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7444 WINNEMAC AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7445 W AINSLIE ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7445 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7445 W CARMEN AVE	N/A	N	N	1949	1949	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7445 W FOSTER AVE	LC11023	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
7445 W STRONG ST	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7445 W WINONA ST	LC11046	N	N	1948	1948	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7445 WINNEMAC AVE	N/A	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7446 W CARMEN AVE	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7447 W CARMEN AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7447 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7447 W WILSON AVE	N/A	N	N	1959	1959	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7447 W WINONA ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 W AINSLIE ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 W AINSLIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 W CARMEN AVE	N/A	N	N	1952	1952	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 W STRONG ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 W WINONA ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7448 WINNEMAC AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7449 W AINSLIE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7449 W CARMEN AVE	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7449 W STRONG ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7449 WINNEMAC AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7450 W AINSLIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7450 WINNEMAC AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7451 W STRONG ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7451 W WINONA ST	LC11047	N	N	1955	1955	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7452 W AINSLIE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7452 W WINONA ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7453 W AINSLIE ST	N/A	N	N	1962	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7453 W AINSLIE ST	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7453 W LAWRENCE AVE	N/A	N	N	2022	2022	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7455 W STRONG ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7455 WINNEMAC AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7456 W AINSLIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7456 W STRONG ST	N/A	N	N	1944	1944	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7457 W AINSLIE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7458 W WINONA ST	N/A	N	N	1947	1947	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7458 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7459 W AINSLIE ST	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7459 W CARMEN AVE	N/A	N	N	1946	1946	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7459 WINNEMAC AVE	N/A	N	N	2006	2006	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7460 W STRONG ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7500 W AINSLIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7500 W AINSLIE ST	N/A	N	N	1940	1940	Maintenance Records	L	L	G	L	Y	5/6/2025	N			N/A	N/A
7500 W CARMEN AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7500 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7500 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7500 W WINONA ST	LC11048	N	N	1951	1951	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7500 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W AINSLIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W AINSLIE ST	N/A	N	N	1990	1990	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W CARMEN AVE	N/A	N	N	2002	2002	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 W WINONA ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7501 WINNEMAC AVE	N/A	N	N	1939	1939	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7502 W AINSLIE ST	N/A	N	N	2009	2009	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7502 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7503 W AINSLIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7503 W AINSLIE ST	N/A	N	N	1989	1989	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7503 W FOSTER AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7503 WINNEMAC AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7504 W AINSLIE ST	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7504 W AINSLIE ST	N/A	N	N	2004	2004	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Neely Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
7504 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7504 W WINONA ST	N/A	N	Y	1959	1959		U	U	U	U	N		N			N/A	N/A
7504 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W AINSIE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W CARMEN AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W FOSTER AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 W WINONA ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7505 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7506 W CARMEN AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7506 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7506 W LAWRENCE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7506 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7507 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7507 W ARDYLE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7507 W FOSTER AVE	N/A	N	N	1961	1961	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7507 W WINONA ST	N/A	N	N	1960	1960	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7507 WINNEMAC AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7508 W AINSIE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7508 W ARDYLE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7508 W CARMEN AVE	N/A	N	N	2000	2000	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7508 W WINONA ST	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7508 WINNEMAC AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7509 W CARMEN AVE	N/A	N	N	2020	2020	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7509 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7509 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7509 WINNEMAC AVE	N/A	N	N	1958	1958	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7510 W AINSIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7510 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7510 W LAWRENCE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7510 W STRONG ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7510 W WINONA ST	N/A	N	N	1984	1984	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7510 WINNEMAC AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7511 W AINSIE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7511 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7511 W CARMEN AVE	N/A	N	N	2015	2015	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7511 W WINONA ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7511 WINNEMAC AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7512 W ARDYLE ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7512 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7512 W STRONG ST	N/A	N	N	1975	1975	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7512 W WINONA ST	N/A	N	N	1950	1950	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7512 WINNEMAC AVE	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7512 S Strong	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7513 W AINSIE ST	N/A	N	N	1955	1955	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7513 W CARMEN AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7513 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7513 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7513 W WINONA ST	N/A	N	N	1997	1997	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 W STRONG ST	N/A	N	N	1977	1977	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 W WINONA ST	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7514 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7515 W AINSIE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7515 W ARDYLE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7515 W STRONG ST	N/A	N	N	1970	1970	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7515 W WINONA ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or (if the notification, if customer refused access to property
7515 WINNEMAC AVE	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W AINSIE ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W GUNNISON ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W WINNEMAC AVE	N/A	N	N	2024	2024	Construction Records	C	C	C	NL	N	N/R	N			N/A	N/A
7516 W WINONA ST	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7517 W AINSIE ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7517 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7517 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7517 W STRONG ST	N/A	N	N	1967	1967	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7517 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W AINSIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W CARMEN AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W STRONG ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7518 W WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7519 W AINSIE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7519 W STRONG ST	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7519 W WINONA ST	N/A	N	N	1975	1975	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7519 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7520 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W AINSIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W STRONG ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W WINNEMAC AVE	N/A	N	N	2021	2021	Construction Records	C	C	C	NL	N	N/R	N			N/A	N/A
7520 W WINONA ST	N/A	N	N	1949	1949	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7521 W AINSIE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7521 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7521 W WINONA ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7521 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7522 W LAWRENCE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7522 W WINONA ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7523 W AINSIE ST	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7523 W WINONA ST	N/A	N	N	1939	1939	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7523 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7524 W AINSIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7524 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7524 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7524 W WINONA ST	N/A	N	N	1961	1961	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7525 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7525 W AINSIE ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7525 W GUNNISON ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7525 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7525 W STRONG ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7525 W WINONA ST	N/A	N	N	1969	1969	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7526 W AINSIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7526 W CARMEN AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7526 W GUNNISON ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7526 W LAWRENCE AVE	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7527 W AINSIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7527 W AINSIE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7527 W CARMEN AVE	N/A	N	N	2007	2007	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7527 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7528 W AINSIE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7528 W STRONG ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7528 W WINONA ST	N/A	N	N	2008	2008	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A


Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
7528 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W AINSLIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W ARDYLE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W CARMEN AVE	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7529 W WINONA ST	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7530 W CARMEN AVE	N/A	N	N	1953	1953	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7530 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7530 W WINONA ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7530 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7531 W ARDYLE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7531 W CARMEN AVE	N/A	N	N	1954	1954	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7531 W FOSTER AVE	N/A	N	N	1979	1979	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7531 W WINONA ST	N/A	N	N	1948	1948	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7531 WINNEMAC AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7532 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7532 W ARDYLE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7532 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7532 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W ARDYLE ST	N/A	N	N	2010	2010	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W CARMEN AVE	N/A	N	N	2003	2003	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W FOSTER AVE	N/A	N	N	1978	1978	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7533 W WINONA ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7534 W CARMEN AVE	N/A	N	N	1953	1953	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7534 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7534 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7535 W CARMEN AVE	N/A	N	N	1971	1971	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7535 W FOSTER AVE	N/A	N	N	1940	1940	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7535 WINNEMAC AVE	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7536 W ARDYLE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7536 W CARMEN AVE	N/A	N	N	1957	1957	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7536 W STRONG ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7536 W WINONA ST	N/A	N	N	1937	1937	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7536 WINNEMAC AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7537 W AINSLIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7537 W CARMEN AVE	N/A	N	N	1941	1941	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7537 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7537 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7538 W LAWRENCE AVE	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7538 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7539 W ARDYLE ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7539 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7539 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7540 W ARDYLE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7540 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7540 W WINONA ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7541 W CARMEN AVE	N/A	N	N	1943	1943	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7541 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7541 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 W AINSLIE ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 W ARDYLE ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 W CARMEN AVE	N/A	N	N	1976	1976	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 W STRONG ST	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7542 WINNEMAC AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7543 W ARDYLE ST	N/A	N	N	1966	1966	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or 150hr notification, if customer refused access to property
7543 W CARMEN AVE	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7543 W FOSTER AVE	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7544 W ARDYLE ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7545 W CARMEN AVE	N/A	N	N	1952	1952	Maintenance Records	L	L	L	L	N	5/6/2025	N			N/A	N/A
7545 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7546 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7546 W ARDYLE ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7546 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7546 W GUNNISON ST	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7547 W ARDYLE ST	N/A	N	N	1947	1947	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7547 W FOSTER AVE	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7548 W CARMEN AVE	N/A	N	N	1959	1959	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7548 W GUNNISON ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7549 W GUNNISON ST	N/A	N	N	1965	1965	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7550 W ARDYLE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7550 W ARDYLE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7553 W FOSTER AVE	N/A	N	N	1958	1958	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7551 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7557 W FOSTER AVE	N/A	N	N	1939	1939	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7557 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7600 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7600 W GUNNISON ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7600 W LAWRENCE AVE	N/A	N	N	Unknown	Unknown	Maintenance Records	O	O	O	NL	N	N/R	N			N/A	N/A
7600 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7600 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7601 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7601 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7601 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7601 W STRONG ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7604 W ARDYLE ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7604 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7604 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7604 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7605 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7605 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7605 W NORRIDGE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7605 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7608 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7608 W GUNNISON ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7608 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7608 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7609 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7609 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7609 W NORRIDGE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7609 W STRONG ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7612 W ARDYLE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7612 W GUNNISON ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7612 W NORRIDGE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7612 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7613 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7613 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7613 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7613 W STRONG ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7616 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7616 W GUNNISON ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7616 W NORRIDGE ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7616 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7617 W ARDYLE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7617 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7617 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Service Address	Lead and Copper Sample site number.	Is this a high-risk Facility or Area?	Service Line Newly Identified Since Last Submitted Inventory	Year PWS-Owned Service Line was Installed	Year Customer Side Service Line was Installed	Source of Information Used for Service Line Identification	Gooseneck/ Pigtail	PWS-Owned Service Line Material	Customer Side Service Line Material	Classification for Entire Service Line	Was Galvanized Service Line Material ever downstream of Lead?	Date Customer Notified of Lead Service Line	Was a Lead Service Line Previously Replaced at this Location?	Date Lead Service Line Replaced	Material of Service Line Replacement	Has the customer refused access to the property?	Date of customer refusal or other notification, if customer refused access to property
7617 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7620 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7620 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7620 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7620 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7621 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7621 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7621 W NORRIDGE ST	N/A	N	N	1964	1964	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7621 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7624 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7624 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7624 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7624 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7625 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7625 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7625 W NORRIDGE ST	N/A	N	N	1951	1951	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7625 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7626 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7626 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7626 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7626 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7629 W AINSLIE ST	N/A	N	N	1963	1963	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7629 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7629 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7629 W STRONG ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7632 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7632 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7632 W NORRIDGE ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7632 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7633 W AINSLIE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7633 W GUNNISON ST	N/A	N	N	1962	1962	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7633 W NORRIDGE ST	N/A	N	N	1961	1961	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A
7633 W STRONG ST	N/A	N	N	1960	1960	Maintenance Records	C	C	C	NL	N	N/R	N			N/A	N/A

Appendix 3

Prioritization Map

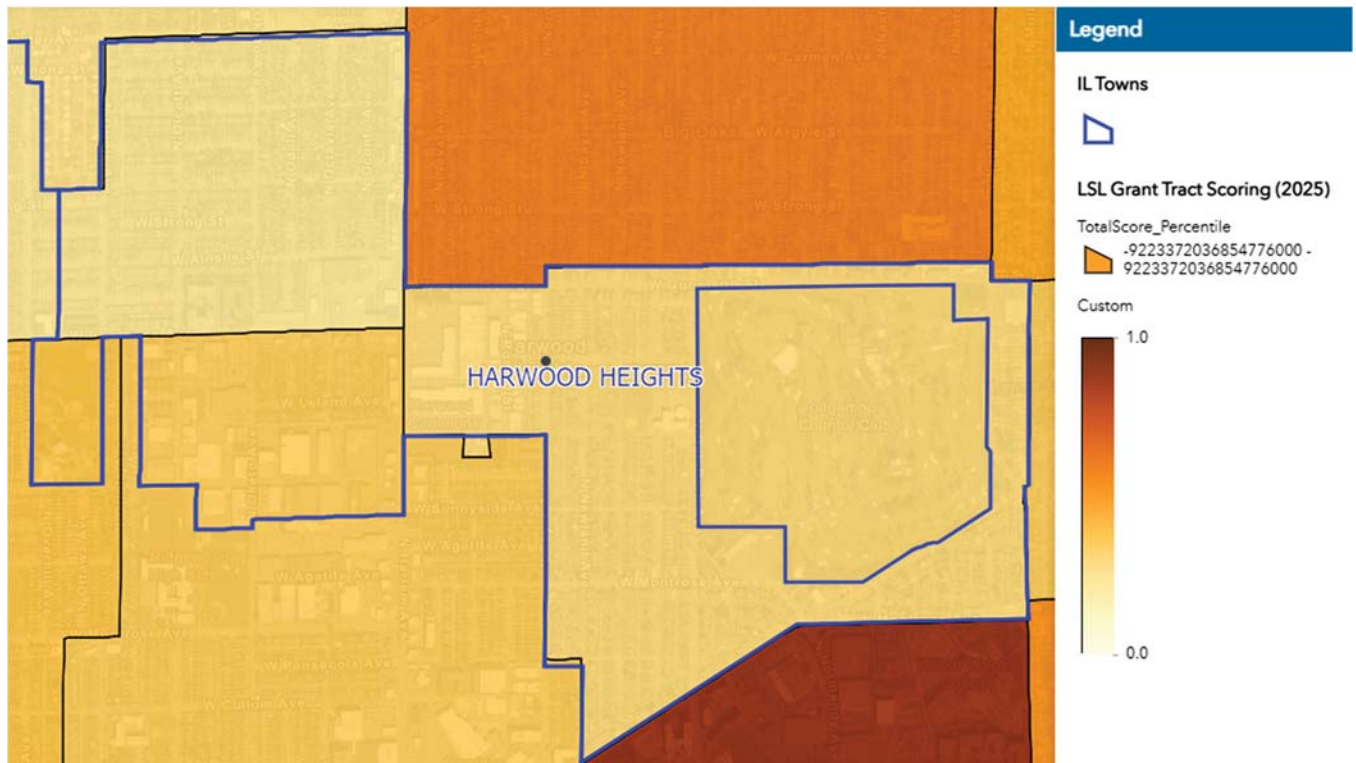

Appendix 4

IEPA SRF PWSLP Scoring System

ADMINISTRATIVE CODE

**TITLE 35: ENVIRONMENTAL PROTECTION
SUBTITLE F: PUBLIC WATER SUPPLIES
CHAPTER II: ENVIRONMENTAL PROTECTION AGENCY
PART 663 PROCEDURES FOR ISSUING LOANS FROM THE PUBLIC WATER SUPPLY
LOAN PROGRAM TO PROVIDE FUNDING FOR LEAD SERVICE LINE
REPLACEMENT
SECTION 663.345 LOAN PRIORITY SCORE**

Section 663.345 Loan Priority Score

- a) Projects will be scored and ranked for inclusion on the Project Priority List using the loan priority score methodology set forth in this Section.
- b) The Agency will calculate the loan priority score by totaling the points awarded in subsections (g) through (n).
- c) The scoring will be based on the information from the most recent American Community Survey 5-year estimate from the US Department of Commerce, Bureau of the Census.
- d) Applicants with a higher loan priority score will be ranked above applicants with a lower loan priority score on the Project Priority List.
- e) Only projects that have submitted a Funding Nomination Form and have a Project Plan approved by the Agency will be scored pursuant to this Section.
- f) The applicant will identify the census tract or tracts of the project area from the U.S. Department of Commerce, Bureau of Census. If more than one census tract is identified for the project area, the percentile rank of each scoring metric identified in subsections (g) through (m) below will be determined for each census tract within the project area. The average of the percentile ranks for the identified census tracts will be calculated and used as the percentile rank for the project area to determine the appropriate points awarded in subsections (g) through (m) below.

g) Median Household Income (MHI):

- 1) A maximum of 100 points may be awarded under this subsection (g).
- 2) The following points will be awarded based on the percentile rank of the MHI of the applicant's project area among all census tracts within the State:

Points	MHI Percentile Rank
100	Project Area Ranks at or below the 5 th Percentile of State MHI
90	Project Area Ranks above the 5 th Percentile and at or below the 10 th Percentile
80	Project Area Ranks above the 10 th Percentile and at or below the 20 th Percentile
70	Project Area Ranks above the 20 th Percentile and at or below the 30 th Percentile
60	Project Area Ranks above the 30 th Percentile and at or below the 40 th Percentile
40	Project Area Ranks above the 40 th Percentile and at or below the 50 th Percentile
20	Project Area Ranks above the 50 th Percentile and at or below the 60 th Percentile
10	Project Area Ranks above the 60 th Percentile and at or below the 70 th Percentile
5	Project Area Ranks above the 70 th Percentile and at or below the 80 th Percentile
0	Project Area Ranks Above the 80 th Percentile of State MHI

h) Children Under the Age of 6

- 1) A maximum of 80 points may be awarded under this subsection (h).
- 2) The following points will be awarded based on the percentile rank of the number of children under the age of 6 within the applicant's project area among all census tracts within the State:

Points	Children Under the Age of 6 Percentile Rank
80	Project Area Ranks Above the 90 th Percentile
70	Project Area Ranks above the 80 th Percentile but at or below the 90 th Percentile
60	Project Area Ranks above the 70 th Percentile but at or below the 80 th Percentile
50	Project Area Ranks above the 60 th Percentile but at or below the 70 th Percentile
40	Project Area Ranks above the 50 th Percentile but at or below the 60 th Percentile
30	Project Area Ranks above the 40 th Percentile but at or below the 50 th Percentile
20	Project Area Ranks above the 30 th Percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th Percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th Percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile

i) Unemployment Rate

- 1) A maximum of 45 points may be awarded under this subsection (i).
- 2) The following points will be awarded based on the percentile rank of the unemployment rate of the applicant's project area among all census tracts within the State:

Points	Unemployment Percentile Rank
45	Project Area Ranks Above the 90 th Percentile
40	Project Area Ranks above the 80 th Percentile but at or below the 90 th Percentile
35	Project Area Ranks above the 70 th Percentile but at or below the 80 th Percentile
30	Project Area Ranks above the 60 th Percentile but at or below the 70 th Percentile
25	Project Area Ranks above the 50 th Percentile but at or below the 60 th Percentile
20	Project Area Ranks above the 40 th Percentile but at or below the 50 th Percentile
15	Project Area Ranks above the 30 th Percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th Percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th Percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile

j) Poverty Rate

- 1) A maximum of 45 points may be awarded under this subsection (j).
- 2) The following points will be awarded based on the percentile rank of the poverty rate of the applicant's project area among all census tracts within the State:

Points	Poverty Rate Percentile Rank
45	Project Area Ranks Above the 90 th Percentile
40	Project Area Ranks above the 80 th Percentile but at or below the 90 th Percentile
35	Project Area Ranks above the 70 th Percentile but at or below the 80 th Percentile
30	Project Area Ranks above the 60 th Percentile but at or below the 70 th Percentile
25	Project Area Ranks above the 50 th Percentile but at or below the 60 th Percentile
20	Project Area Ranks above the 40 th Percentile but at or below the 50 th Percentile
15	Project Area Ranks above the 30 th Percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th Percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th Percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile

k) Social Security Rate

- 1) A maximum of 45 points may be awarded under this subsection (k).
- 2) The following points will be awarded based on the percentile rank of the social security rate of the applicant's project area among all census tracts within the State:

Points	Social Security Rate Percentile Rank
45	Project Area Ranks Above the 90 th Percentile
40	Project Area Ranks above the 80 th Percentile but at or below the 90 th Percentile
35	Project Area Ranks above the 70 th Percentile but at or below the 80 th Percentile
30	Project Area Ranks above the 60 th Percentile but at or below the 70 th Percentile
25	Project Area Ranks above the 50 th Percentile but at or below the 60 th Percentile
20	Project Area Ranks above the 40 th Percentile but at or below the 50 th Percentile
15	Project Area Ranks above the 30 th Percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th Percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th Percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile

l) Supplemental Security Income

- 1) A maximum of 45 points may be awarded under this subsection (l).
- 2) The following points will be awarded based on the percentile rank of the supplemental security income rate of the applicant's project area among all census tracts within the State:

Points	Supplemental Security Income Rate Percentile Rank
45	Project Area Ranks Above the 90 th Percentile
40	Project Area Ranks above the 80 th Percentile but at or below the 90 th Percentile
35	Project Area Ranks above the 70 th Percentile but at or below the 80 th Percentile
30	Project Area Ranks above the 60 th Percentile but at or below the 70 th Percentile
25	Project Area Ranks above the 50 th Percentile but at or below the 60 th Percentile
20	Project Area Ranks above the 40 th Percentile but at or below the 50 th Percentile
15	Project Area Ranks above the 30 th Percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th Percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th Percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile

m) Houses Built Pre-1990

- 1) A maximum of 45 points may be awarded under this subsection (m).
- 2) The following points will be awarded based on the percentile rank of the number of housing units built before 1990 within the applicant's project area among all census tracts within the State:

Points	Housing Units Built Pre-1990 Percentile Rank
45	Project Area Ranks Above the 90 th Percentile
40	Project Area Ranks above the 80 th percentile but at or below the 90 th Percentile
35	Project Area Ranks above the 70 th percentile but at or below the 80 th Percentile
30	Project Area Ranks above the 60 th percentile but at or below the 70 th Percentile
25	Project Area Ranks above the 50 th percentile but at or below the 60 th Percentile
20	Project Area Ranks above the 40 th percentile but at or below the 50 th Percentile
15	Project Area Ranks above the 30 th percentile but at or below the 40 th Percentile
10	Project Area Ranks above the 20 th percentile but at or below the 30 th Percentile
5	Project Area Ranks above the 10 th percentile but at or below the 20 th Percentile
0	Project Area Ranks at or below the 10 th Percentile


n) Lead Service Line Burden

- 1) A maximum of 45 points may be awarded under this subsection (n).
- 2) The following points will be awarded based on the total number of lead service lines as a percentage of all water service lines reported in the Material Inventory.

Points	Lead Service Line Percentage
45	Lead Service Lines are 75%- 100% of the Material Inventory
30	Lead Service Lines are 50%-74.99% of the Material Inventory
15	Lead Service Lines are 25%-49.99% of the Material Inventory
0	Lead Service Lines are 0%-24.99% of the Material Inventory

Appendix 5

LSLR Details

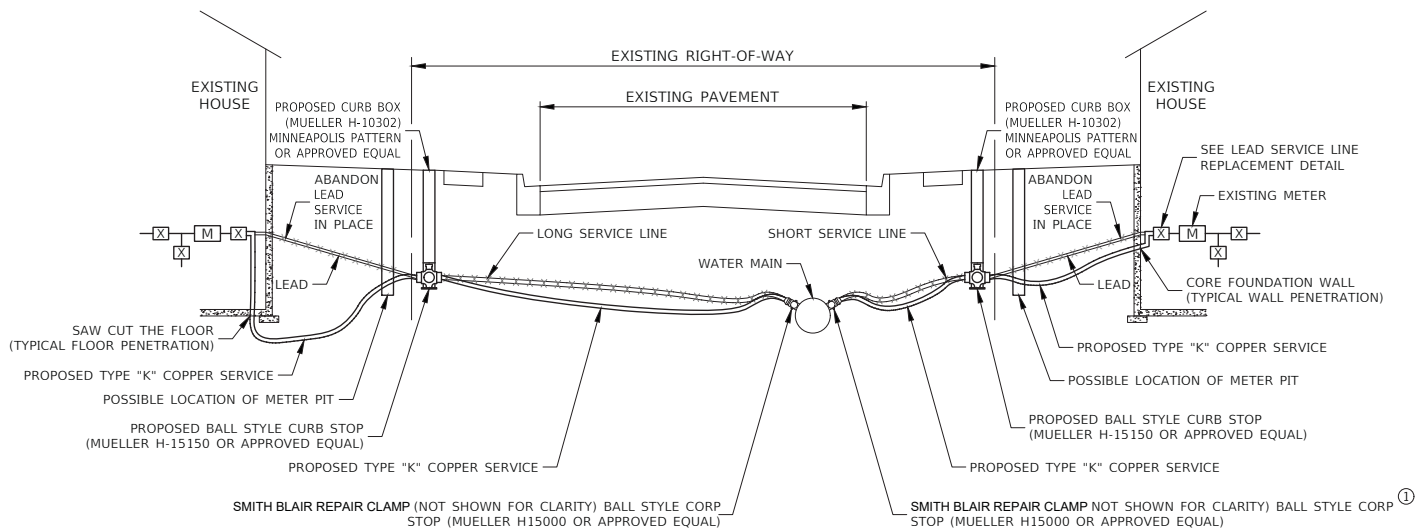


NOTE:
 ① SEE SPECIFICATIONS FOR WATER MAIN TAPPING.

FULL LEAD WATER SERVICE REPLACEMENT
 (COPPER)



22R0906 02-LSLR-OTLS-01

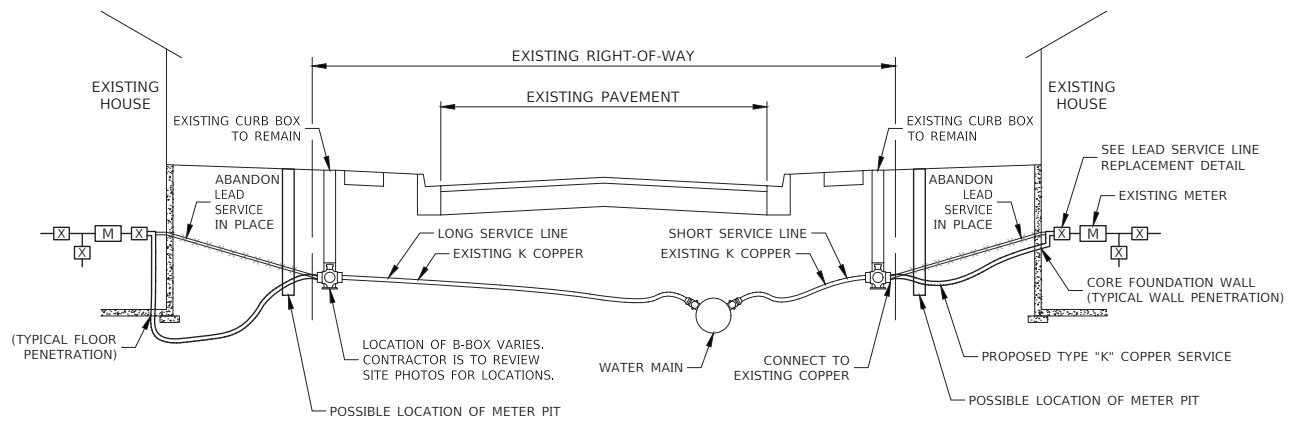


NOTE:

- ① ONLY CURB BOXES THAT ARE NOT FUNCTIONING ARE TO BE REPLACED PER THE SPECIAL PROVISIONS. ANY CURB BOXES THAT ARE BURIED SHALL BE ADJUSTED PER THE SPECIAL PROVISIONS.

PARTIAL LEAD WATER SERVICE REPLACEMENT
PRIVATE SIDE (COPPER)



22R0906 02-LSLR-OTLS-01

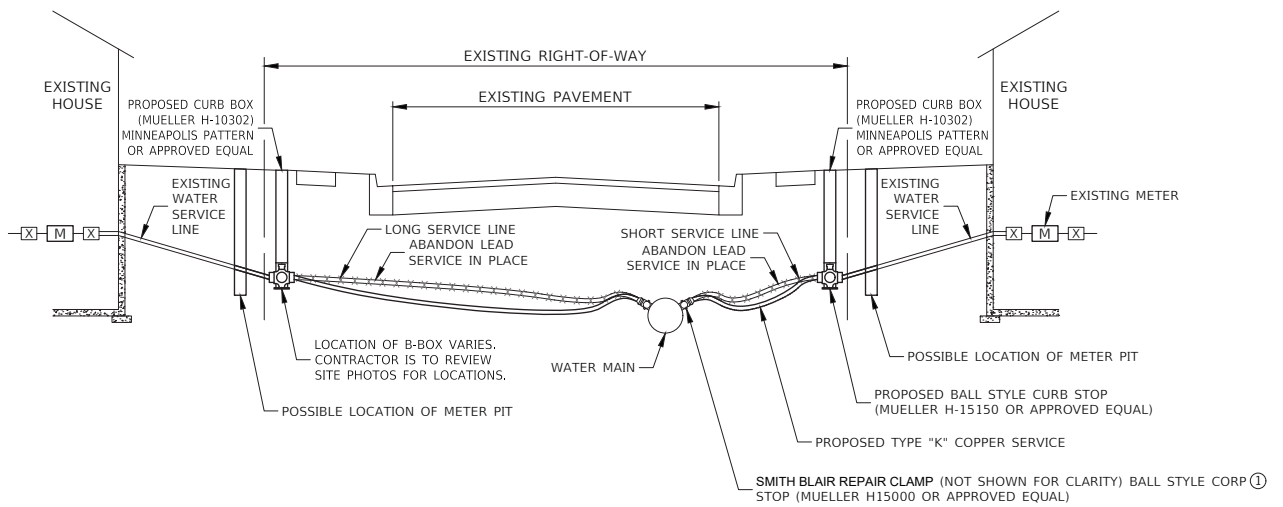

PARTIAL LEAD WATER SERVICE REPLACEMENT
PUBLIC SIDE (COPPER)



22R0906 02-LSLR-OTLS-01

Appendix 6

Lead Service Line Replacement Outreach Materials

This notice contains important information about your water service and may affect your rights. We encourage you to have this notice translated in full into a language you understand and before you make any decisions that may be required under this notice.

Ang abisong ito ay naglalaman ng mahalagang impormasyon tungkol sa iyong serbisyo sa tubig at maaaring makaapekto sa iyong mga karapatan. Hinihikayat namin kayo na isalin nang buo ang abisong ito sa wikang naiintindihan ninyo at bago kayo gumawa ng anumang mga desisyon na maaaring kailanganin sa abisong ito.

Niniejsze zawiadomienie zawiera ważne informacje na temat Państwa przyłącza wodociągowego i może mieć wpływ na Państwa prawa. Przed podjęciem jakichkolwiek decyzji, które mogą być wymagane na mocy niniejszego zawiadomienia, zachęcamy Państwa do przetłumaczenia całości niniejszego zawiadomienia na język, który będzie dla Państwa zrozumiały.

اس نوٹس میں آپ کی پانی کی سروسز سے متعلق اہم ترین معلومات موجود ہیں اور یہ آپ کے حقوق کو متاثر کر سکتا ہے۔ ہم آپ کو ترغیب دیں گے کہ آپ اس نوٹس کا مکمل طور پر اس زبان میں ترجمہ کروائیں جو آپ سمجھتے ہوں اور ممکن ہے کہ آپ کے کوئی فیصلہ لینے سے قبل اس نوٹس کے تحت یہ درکار بھی ہو۔

Este aviso contiene información importante sobre su servicio de agua y puede afectar sus derechos. Lo animamos a que traduzca este aviso a un idioma que comprenda antes de tomar cualquier decisión que pueda ser necesaria en virtud del mismo.

이 통지서에는 귀하의 권리에 영향을 미칠 수 있는 수도 서비스에 관한 중요한 정보가 제시되어 있습니다. 이 통지서에서 요구하는 결정을 내리기 전에 이 통지서를 귀하가 이해할 수 있는 언어로 번역하시기 바랍니다.

本通知包含有关您的供水服务的重要信息，可能会影响到您的权利。在您做出本通知所要求的任何决定之前，我们鼓励您将本通知完整地翻译成您可理解的语言。

IMPORTANT INFORMATION ABOUT LEAD IN YOUR DRINKING WATER

The Community Water System (CWS) has determined that your property is likely serviced by a lead water pipe. Lead can cause serious health problems, especially for pregnant women and children 6 years and younger. Please read this notice closely to see what you can do to reduce lead in your drinking water.

The CWS provides water that protects our residents from lead leaching into our water system. The CWS has not had a recent violation for lead levels. However, proper maintenance of the system to prevent the leaching of lead costs time, energy, and money. There is also the potential that something might go wrong and people with lead service lines would be exposed to lead in their drinking water.

Health Effects of Lead

It can cause damage to the brain and kidneys, and can interfere with the production of red blood cells that carry oxygen to all parts of your body. The greatest risk of lead exposure is to infants, young children, and pregnant women. Scientists have linked the effects of lead on the brain with lowered IQ in children. Adults with kidney problems and high blood pressure can be affected by low levels of lead more than healthy adults. Lead is stored in the bones and can be released later in life. During pregnancy, the child receives lead from the mother's bones, which may affect brain development.

Sources of Lead

The source of water from Lake Michigan does not contain lead. When water is in contact with service lines or plumbing that contains lead for several hours, the lead may enter drinking water. Homes built before the 1960s in our community are more likely to have lead service lines and lead in solder and plumbing fixtures.

Don't forget, most lead exposure is still from small children ingesting lead paint, dust, and soil. In addition, lead can be found in certain types of pottery, pewter, brass fixtures, food, and cosmetics. Other sources include exposure in the work place and exposure from certain hobbies (lead can be carried on clothing or shoes). Lead is found in some toys, some playground equipment, and some children's metal jewelry. Wash your children's hands and toys often as they can come into contact with dirt and dust containing lead.

Steps That You Can Take to Reduce Your Exposure to Lead in Your Drinking Water

1. *Run your water to flush out lead.*
 - a. If the plumbing in your home is accessible; you may be able to inspect your own plumbing to

- determine whether you have a lead service line. Otherwise, you will most likely have to hire a plumber, or allow the Village to inspect your water line.
- b. If you do not have a lead service line, running the water for 1 - 2 minutes at the kitchen tap should clear the lead from your household plumbing to the kitchen tap. Once you have done this, fill a container with water and store it in the refrigerator for drinking, cooking, and preparing baby formula throughout the day.
 - c. If you do have a lead service line, flushing times can vary based on the length of your lead service line and the plumbing configuration in your home. The length of lead service lines varies considerably.
 - d. The following flushing guidelines are recommended by the American Water Works Association after a lead service line is replaced:
 - i. Find all the faucets that will drain, including the basement and all floors in your house.
 - ii. Remove aerators and screens whenever possible, including the shower heads, from all faucets you plan to flush.
 - iii. Include the laundry tubs, hose-bibs, bathtubs, and showers as flushing points.
 - iv. After all the aerators are off, open the faucets in the basement or lowest floor in the house. Leave all faucets running at highest rate possible, using cold water.
 - v. After the faucets are all open in lowest floor, open the faucets on next highest floor of the house. Continue until faucets are open on all floors.
 - vi. After all faucets are opened, leave the water running for at least 30 minutes.
 - vii. After 30 minutes, turn off the first faucet you opened and continue to turn off other faucets in the same order you turned them on.
 - viii. Clean aerators/screens at each faucet. You may need to replace screens/aerators if too old or worn
2. *Use cold water for drinking, cooking, and preparing baby formula.*
 - a. Do not cook with or drink water from the hot water tap; lead dissolves more easily into hot water.
 - b. Do not use water from the hot water tap to make baby formula.
 3. *Look for alternative sources or treatment of water.*
 - a. You may want to consider purchasing bottled water; or
 - b. Purchase a water filter that is certified to remove "total lead". The filter should be NSF 53 and NSF 42 certified.
 4. *Clean and remove any debris from faucet aerators* on a regular basis.
 5. *Do not boil water to remove lead.* Boiling water will not reduce lead.
 6. *Purchase lead free faucets and plumbing components.*
 7. *Remove the entire lead service line.*
 - a. *As part of the separate Lead Service Line Replacement program, should you agree to participate, the Village will replace your lead service line from the water main to the meter inside your home.*
 8. *Test your water for lead.*
 - a. Call us at: 815-412-2015 to find out how to get your water tested for lead. While we do not do the testing, we can provide a list of laboratories certified to do the testing. Laboratories will send you the bottles for sample collection. Please note that we are not affiliated with the laboratories, and they will charge you a fee.
 - If test results indicate a lead level above 15 ug/L, bottled water should be used by pregnant women, breast-feeding women, young children, and formula-fed infants.
 - b. Approximately one month after service line replacement, testing is recommended. The sample should be a first-draw sample after water has not been used for at least 6 hours. The sample must be collected from a tap used frequently inside the home, preferably from the kitchen.
 - c. As a precaution, until the sample is collected and analyzed, the customer is recommended to do a mini-flush of premise plumbing by running tap water each morning or when the water sits in the pipe for at least 6 hours. Flush for 5 minutes to displace water that has been sitting in the pipes inside the house and in the service line. This could include taking a shower, running the dishwasher, flushing a toilet, collecting water for plants/garden, or running the faucet. The customer should do this before using any

water for drinking, cooking, infant formula, and so on. Daily miniflushes should continue for six months or until lead sample results show the lead level is below the regulatory guideline. The customer should clean debris from aerators and screens once a month for six months. After six months, clean debris twice a year.

For More Information

Call us at () or visit our website at (). For more information on reducing lead exposure around your home/building and the health effects of lead, visit EPA's website at www.epa.gov/lead or contact your health care provider.

Thank you for reading this notice, and we hope to hear from you soon.

Salutation